

## City of Alexandria Storm Sewer Capacity Analysis (CASSCA)

### Backlick Run Condition Assessment

**PREPARED FOR:** City of Alexandria, CH2M Hill  
**PREPARED BY:** Michael Baker Jr., Inc.  
**DATE:** October 9, 2013 (Revised May 26, 2015)

### Introduction

As part of the City of Alexandria CASSCA project, a visual inspection of the storm sewer structures within Backlick Run was completed. In total, 398 storm sewer structures were inspected. This included 182 manholes, 180 inlets, 19 I/O structures, 16 culvert points, and one control device. In addition, 704 storm sewer pipe segments were inspected. This Technical Memorandum summarizes the results of the field investigations in the Backlick Run watershed.

The inspections were performed by Video Pipe Services (VPS) using the “Lamping” technique. Lamping involves the use of a pole-mounted optical zoom camera to visually assess the condition of the buried infrastructure. The lamping method is an unconfined space inspection procedure that does not require entry into a manhole. The use of an optical zoom camera allows field crews to remain at ground level of a storm structure and screen the structure and its connecting pipes for defects. The lamping technique is a preliminary inspection tool to assess the condition of buried infrastructure and determine if further investigation or repair is warranted. In addition to visually inspecting the stormwater structures and pipes, field crews from VPS also obtained the size and invert measurements of storm pipes.

Closed-Circuit Television (CCTV) pipe inspections were also conducted in Backlick Run as part of the CASSCA project, but only for the corrugated metal pipe (CMP) segments. The number of CMP segments represents a small fraction (less than 1%) of the total storm infrastructure length in Backlick Run watershed. The results of the condition assessment of the CMP inspections will be provided in a separate memorandum.

The storm sewer structures and pipes were inspected utilizing the Pipeline Assessment and Certification Program (PACP©) coding standards developed by the National Association of Sewer Service Companies, and were assessed further using the Sewer Condition Risk Evaluation Algorithm Model (SCREAM™). In addition to visually inspecting the storm structures and pipes, field crews from VPS also obtained the size and invert measurements of storm pipes. The data collected from the field work was logged into a database using the *SCREAM Manhole and Lamping Inspection Field Tool*, revised August 2011 (Revision 6) and included as Appendix B in the *CASSCA Field Investigation Manual* delivered to the City of Alexandria in August 2011.

SCREAM is a system of assessment algorithms and tables that synthesizes data produced from asset inspection methods such as CCTV, zoom camera lamping, smoke & dye testing, sonar, laser profiling, manhole and catch basin visual inspections. Each structure or pipe segment was assigned a score according to the visual inspection results. The SCREAM scoring system produces scores for the overall asset condition, and also for the categories of Structural, Maintenance and I/I group defects for each asset. A scoring scale of 1 to 100 for each defect is automatically assigned when the operator enters the defect code. A score of 1 represents a very minor defect and a score of 100 represents the most severe defect. To represent the overall condition of a pipe or MH, an overall score is derived from the scores of the individual defects utilizing the SCREAM program.

The following defect categories as shown in Table 1 have been established in SCREAM for different conditions of sewer facilities along with corresponding ranges for each defect category. Note that the examples provided are meant to show a typical defect found in an asset that would result in the condition category rating.


**Table 1 – SCREAM Defect Categories**

Defect Category	Score Range	Example
<b>None</b>	0	n/a
<b>Few</b>	1-20	Infiltration weeper
<b>Minimum</b>	21-40	Manhole cracks less than 1/8"
<b>Moderate</b>	41-60	Spalling of chamber wall, large infiltration flow
<b>Major</b>	61-80	Large cracks in cover or frame
<b>Extreme</b>	81-100	Collapsed Pipe

## Structure Inspections

As part of this inspection task, 398 storm structures were inspected in the Backlick Run watershed. Figure 1 shows the number of structures identified within each defect category identified in the previous section. Figure 2 is provided to show the geographic location of each structure within the Backlick Run watershed, color coded to its defect category. The average condition score of the 398 storm structures was 38 (Minimum). Twenty-seven (27) structures had scores of 61 or higher, placing them in either major or extreme categories. About 23% of the structures showed few to no defects, while approximately 70% of the structures ranked in the minimum to moderate defect categories.

There were 32 structures for which inspections were partially conducted at the surface only (manhole lid is locked, bolted, or jammed) or not conducted at all (structure could not be found in the field). Appendix C: Summary of Structures Not Inspected provides a breakdown of the reasons why these manholes were not inspected.

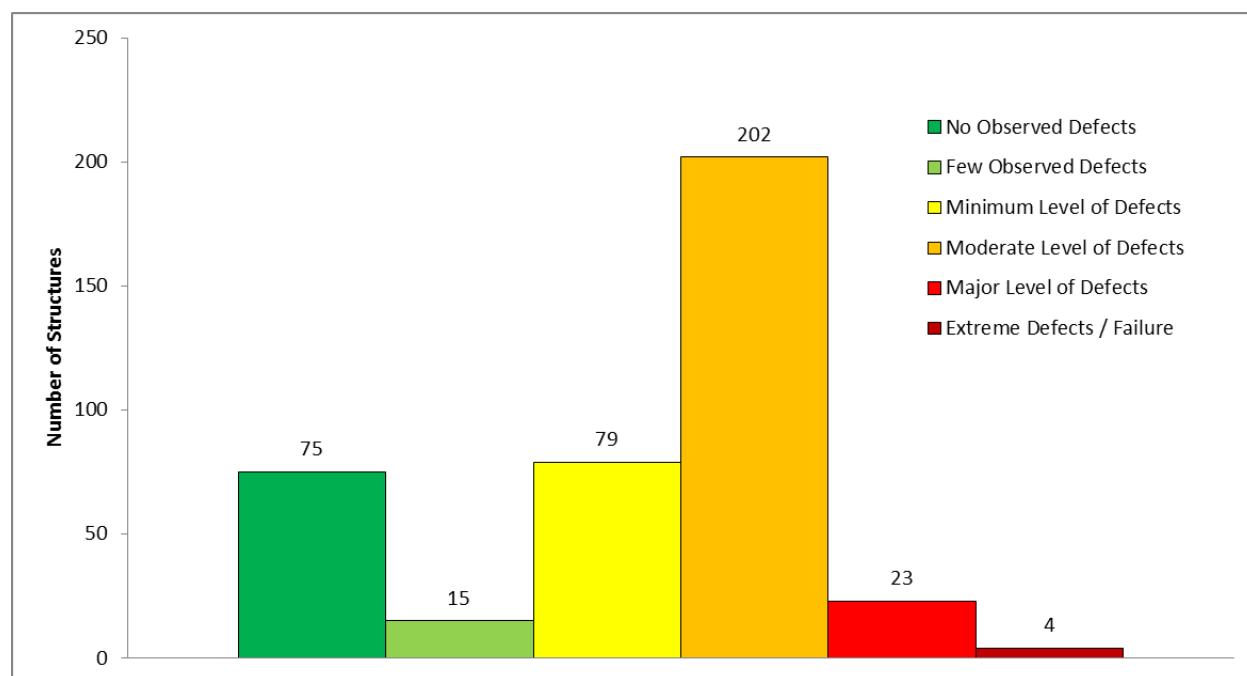

**Figure 1. Structure Inspection Summary.**

Figure 2. Overall Condition of Storm Structures (Color coded by Severity of Defects).


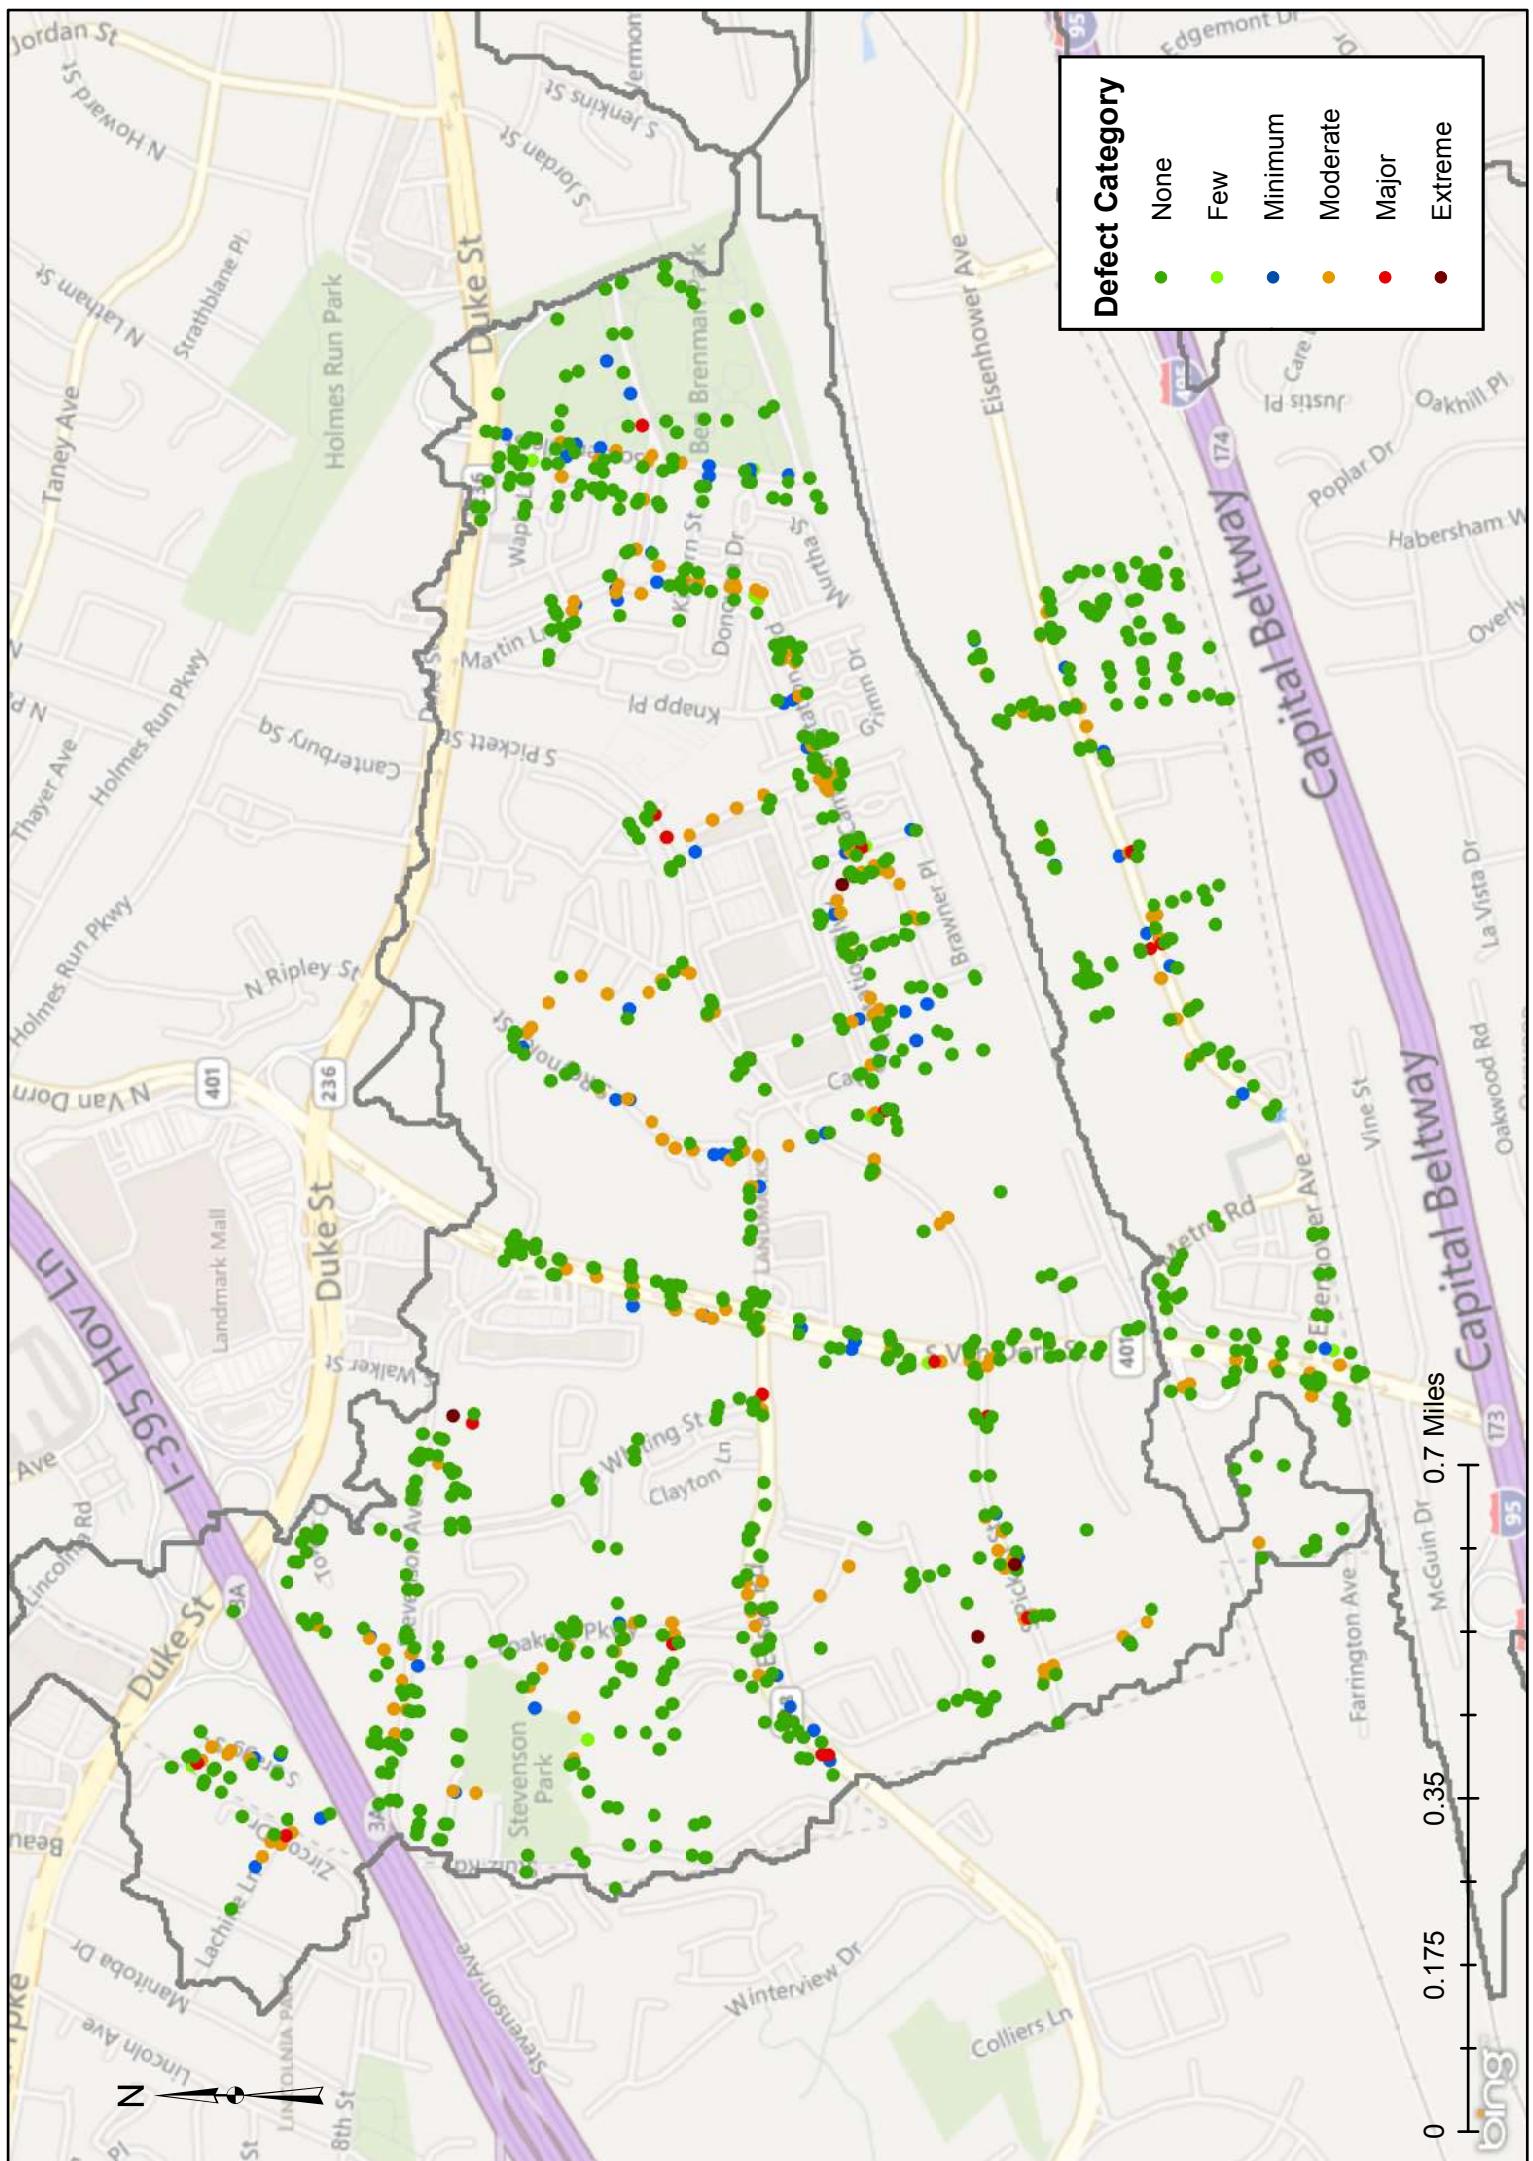


Figure 3 displays the location of the structures classified with major and extreme damage only. In the Backlick Run watershed, structures with high defect scores are distributed near Stevenson Avenue, S Pickett Street, and Cameron Station Boulevard. The inspection results of the structures were broken down by structure component for further detailed condition assessment. Table 2 lists the number of observed defects by component and severity. Note that the table shows a count of the number of defects found in each component and their respective severity across all structures, not the number of inspections performed. Multiple defects may be found in a single component of a structure.

**Table 2 - Count of Structure Inspection Observations by MH Component and Severity**

Structure Component	Min	Mod	Maj	Extreme
Cover	1	1	1	3
Frame	9	5	2	3
Frame Base Seal	351	19	1	0
Chimney/Shft	356	22	1	0
Chamber	651	92	19	0
Bench	13	7	0	1
Channel	9	13	3	1
Pipe Connection	15	0	1	1

**Figure 3. Location of Storm Structures in the "Major" and "Extreme" Categories (Color coded by Severity of Defects).**

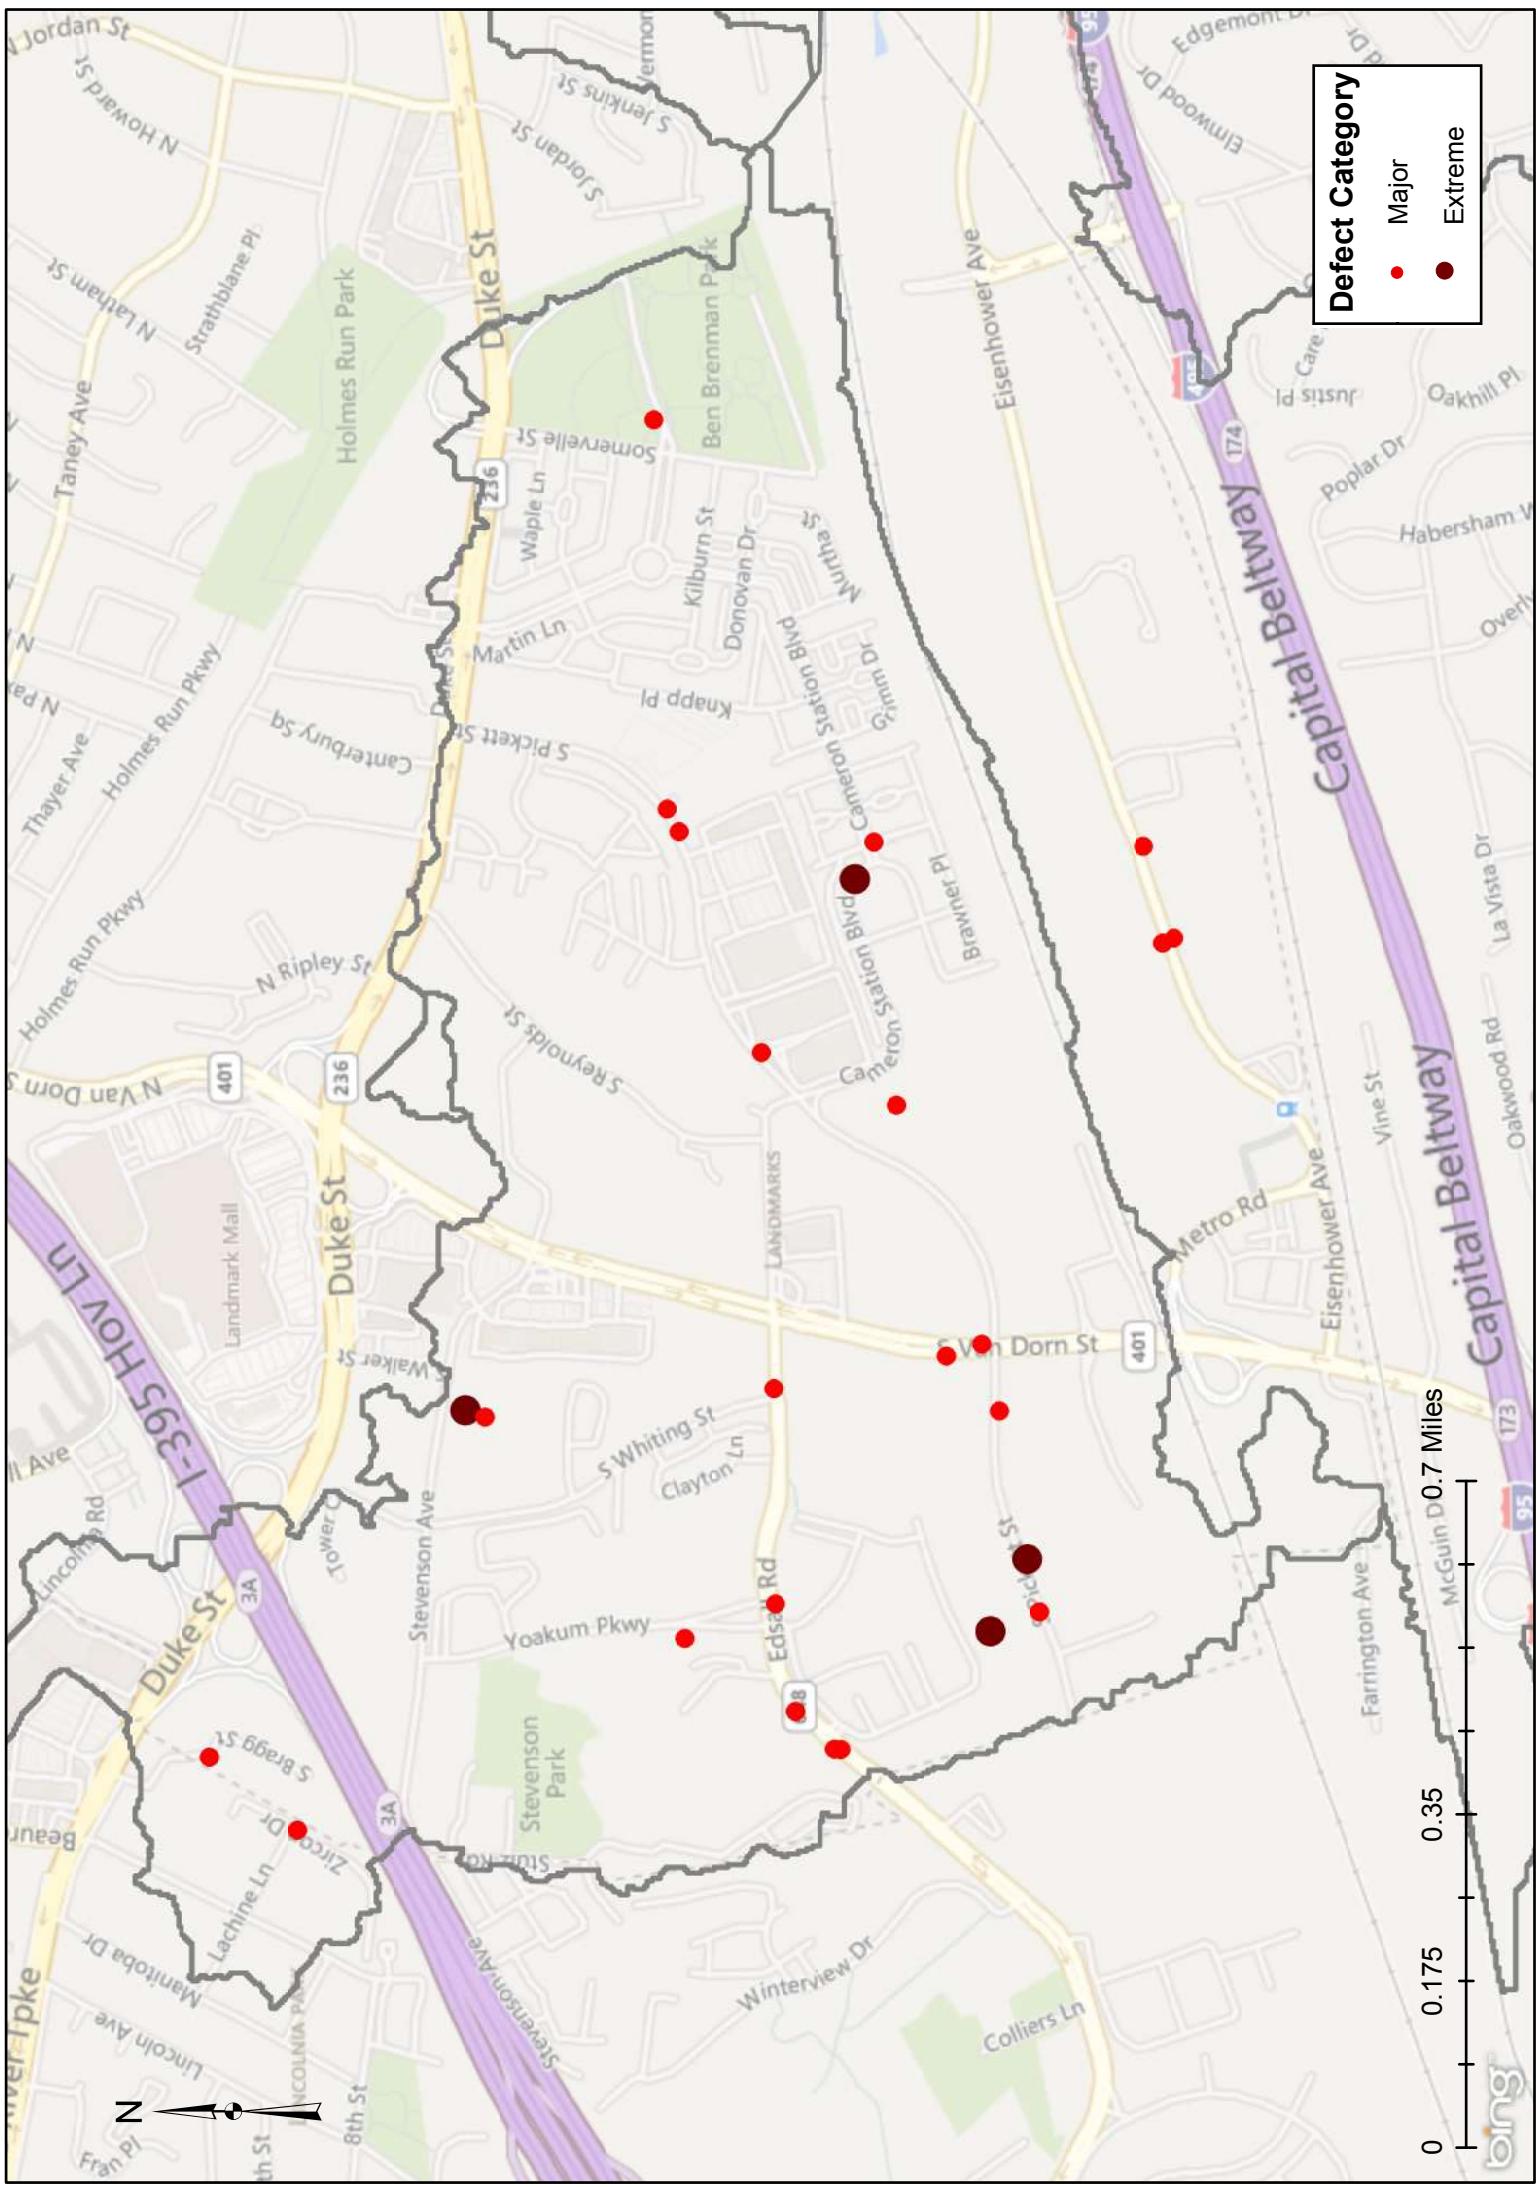

Observed defects of lower severity (Minimum and Moderate defect categories) were frequently associated with the chamber, chimney, and frame base seal components. Twenty-eight (28) examples of major defects were observed in the Backlick Run watershed, and nine (9) examples of extreme defects were recorded.

Examples of problems in the moderate category for the frame base seal, chimney, and chamber are shown in Figures 4, 5, and 6, respectively.



**Figure 4. Moderate Frame Base Seal Damage on Structure 001025SMH  
(Overall SCREAM Score = 59).**



**Figure 5. Moderate Chimney Damage on Structure 001102SMH  
(Overall SCREAM Score = 62).**



**Figure 6. Moderate Chamber Wall Damage on Structure 005073IN  
(Overall SCREAM Score = 42).**

The problems in the extreme category were associated with the cover and frame, and some of the lower manhole components, such as the bench, channel, or pipe connection. Examples of problems in the extreme category are cracked and separated covers, frame offsets greater than 4 inches, more than 5 gallons of debris settled at the bottom of a structure, or cracks larger than  $\frac{1}{4}$  inch wide at the pipe connection. Figures 7 through 10 are examples of damage in each of the component areas with problems in the extreme category.



**Figure 7. Broken Inlet Grate at Structure 004339IN  
(Overall SCREAM Score = 98).**



**Figure 8. Offset Frame in Structure 001333SMH  
(Overall SCREAM Score = 78).**



**Figure 9. Separated Pipe Connection in Structure 002155IN  
(Overall SCREAM Score = 52).**



**Figure 10. Heavy Debris in Structure 001024SMH  
(Overall SCREAM Score = 64).**

The structures that ranked among the highest in overall SCREAM score (higher than 80, “extreme”) tended to have extreme or major problems associated with the cover or frame. The structures with scores in the moderate and major categories (scores 41-60 and 61-80) tended to exhibit multiple defects of lesser severity.

Appendix A: Structure Inspection Summary provides a summary of the total SCREAM defect score of each storm structure, and Appendix B: Structure Inspection Report provides a detailed report of the defects associated with each inspection.

## Pipeline Inspections

In total, 704 storm sewer pipes were inspected in the Backlick Run watershed. Figure 11 shows the number of pipe segments within each defect category. Figure 12 shows a map of the location of each inspected pipeline, color coded by the defect categories identified previously in the memorandum. The average condition score of the 704 storm pipe segments inspected within the Backlick Run watershed was 0.2 (Few to No defects). Inspection results in Backlick Run watershed showed that the pipe segments were observed to be in generally excellent condition, with no defect observed in 98% of the pipes.


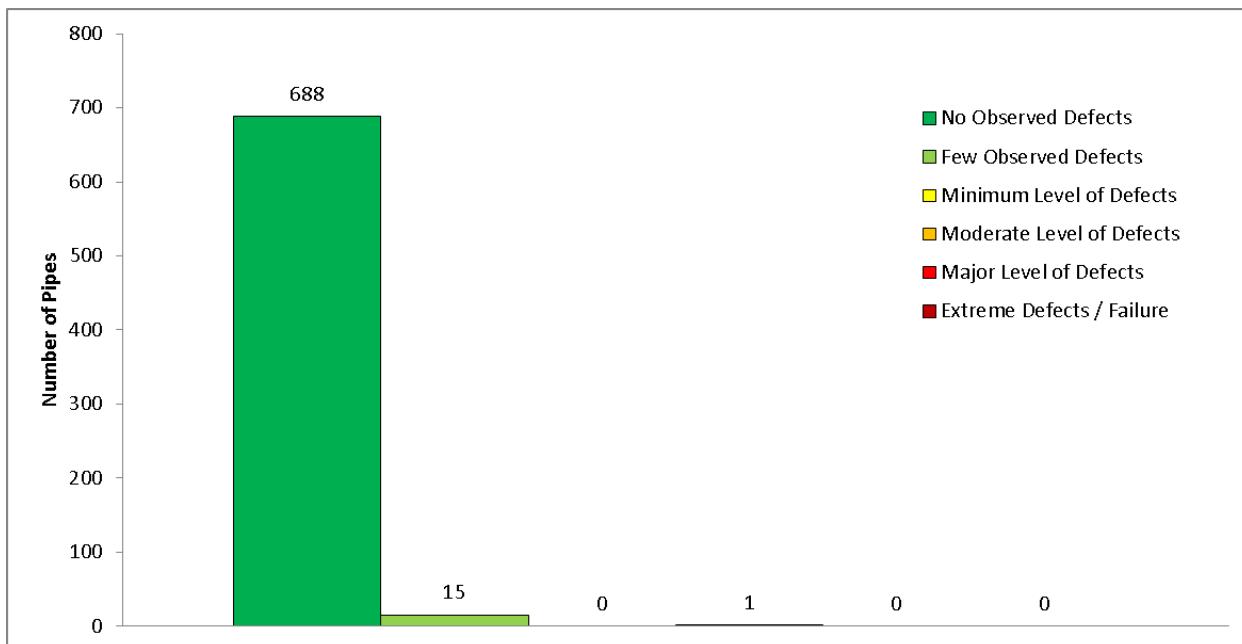


Figure 11. Pipe Lamping Inspection Summary.

Figure 12. Overall Condition of Storm Pipelines (Color coded by Severity of Defects).

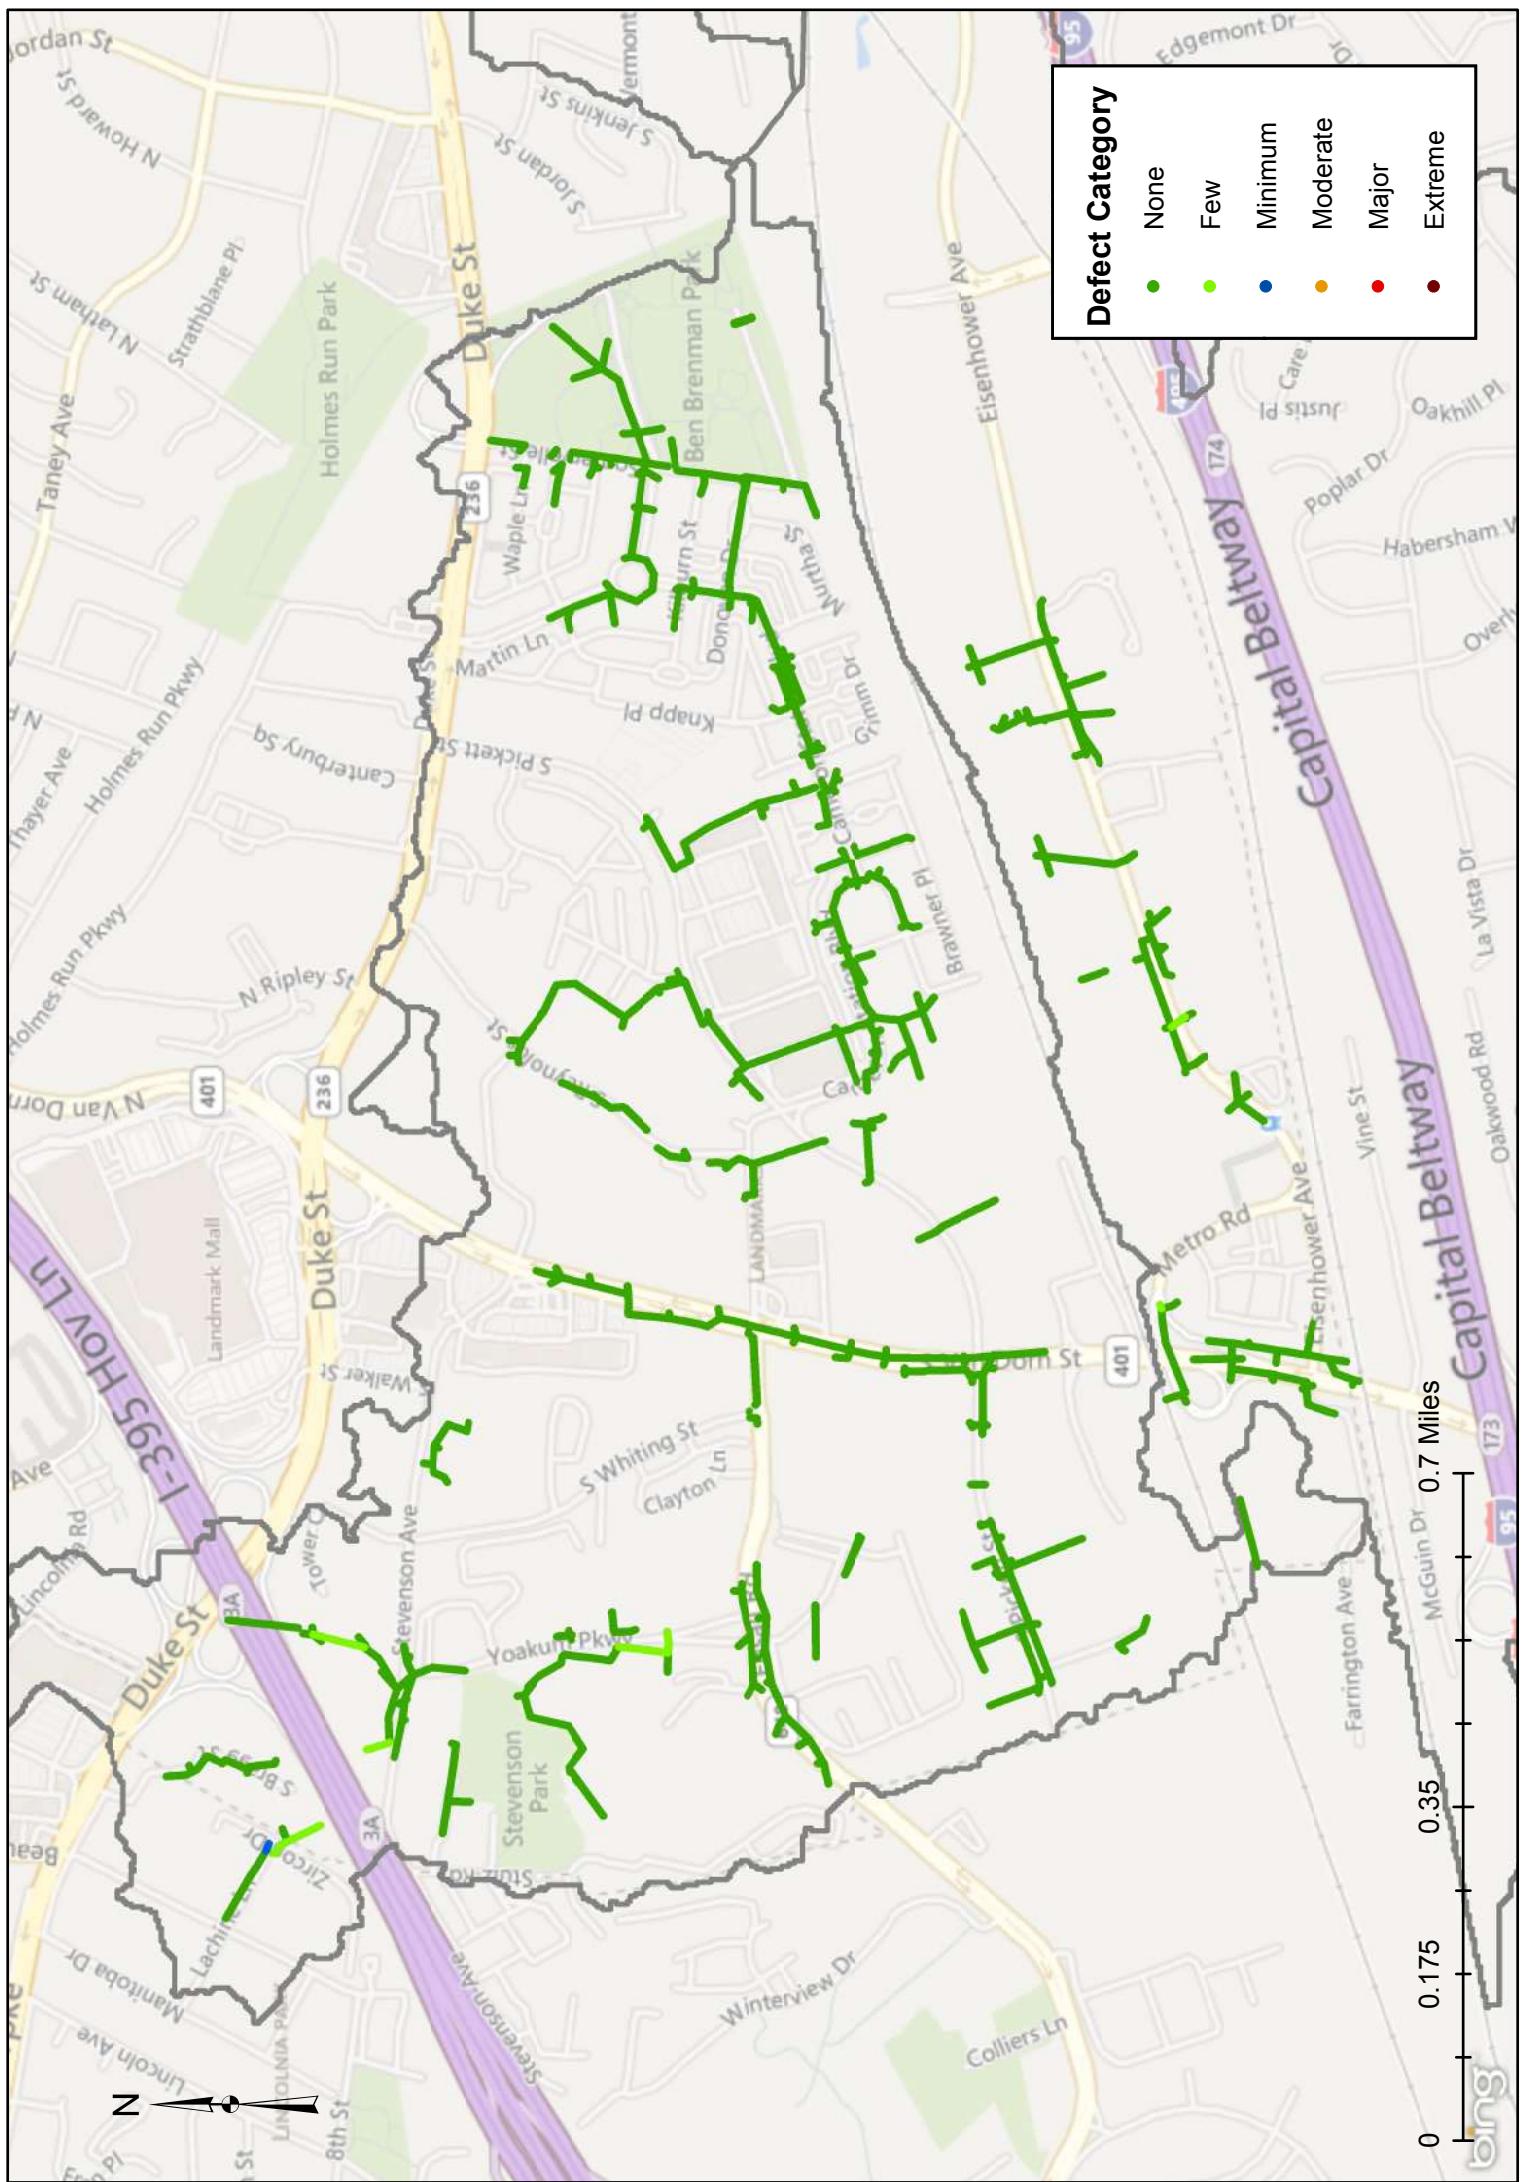

Several cracks were observed in one pipe segment as shown in Figure 13. This segment has a SCREAM score of 9 (Few). Root intrusions were observed in one pipe segment as shown in Figure 14. This segment has a SCREAM score of 50 (Moderate). Limited infiltration was observed in the segments with SCREAM scores less than 10. Figure 15 is an example of the level of infiltration in these storm pipes.


Appendix D: Summary of Observed Pipe Defects lists each inspected pipe with a defect, the nature of the problem(s), and the SCREAM total score.



**Figure 13. Cracks in 24-in Storm Pipe between Structures 003601SMH and 001166SMH  
(Overall SCREAM Score = 9).**



**Figure 14. Root Intrusion in 15-in Storm Pipe between Structures 004141IN and 004140IN  
(Overall SCREAM Score = 50).**

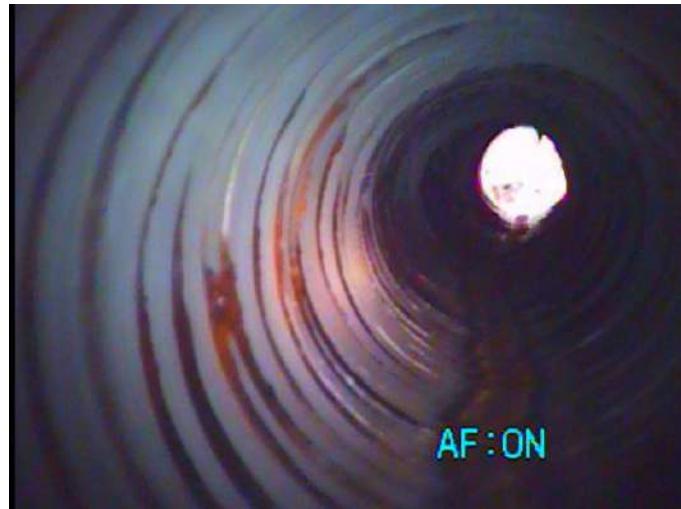

**Figure 15. Infiltration in 36-in Storm Pipe at Structure 000229CP  
(Overall SCREAM Score = 7).**

## **Summary**

In total, 398 storm sewer structures and 704 associated pipeline segments were visually inspected for defects and damage using the lamping technique. Overall, the storm sewer infrastructure within the Backlick Run watershed is in good condition. The average condition score for storm structures was 38 (Minimum) and the average condition score for pipe segments was 0.2 (Few). Less than one percent of the structures and no storm pipes inspected had observed defects in the extreme category (scores 81-100).

**Appendix A – Structure Inspection Summary**

**(Sorted by Defect Score)**



# SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Total MH Score

## Alexandria - Backlick Run

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	003048IN	X	840	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	99	99	0	2.43	3
Backlick Run	003070IN	X	841	S PICKETT ST	Parking Lot	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	99	99	0	2.43	3
Backlick Run	004339IN	X	200	S WHITING ST	Yard-Back	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	98	98	0	2.43	2
Backlick Run	001137SMH	X	400	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	94	94	0	2.43	2
Backlick Run	000745SMH	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	79	79	0	2.43	4
Backlick Run	001333SMH	X	99	S BRAGG ST	Easement	<a href="#">02/13/2013</a>	Truck 1	Complete Inspection	78	78	0	1.5	2
Backlick Run	004127IN	X	27	S BRAGG ST	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	71	69	5	2.43	3
Backlick Run	001452SMH	X	6000	EDSALL RD	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	70	71	0	1.35	5
Backlick Run	004935SMH	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	70	70	0	2.43	3
Backlick Run	001033SMH	X	520	S VAN DORN ST	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	69	70	0	1.35	5
Backlick Run	001764SMH	X	211	YOAKUM PY	Yard-Front	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	69	70	0	1.5	3
Backlick Run	001772SMH	X	6161	EDSALL RD	Light Highway Rural Streets	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	69	70	0	2.43	3
Backlick Run	001305SMH	X	200	S PICKETT ST	Driveway	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	65	66	0	2.43	3
Backlick Run	001024SMH	X	520	CAMERON STATION BV	Easement	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	64	14	59	2.43	2
Backlick Run	001139SMH	X	320	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	64	52	35	2.43	2
Backlick Run	001306SMH	X	200	S PICKETT ST	Light Highway Rural Streets	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	64	65	0	2.43	2
Backlick Run	001160SMH	X	5300	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	63	64	0	2.43	3
Backlick Run	003489IN	X	5001	EISENHOWER AV	Easement	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	63	62	2	2.43	3
Backlick Run	009209IN	X		EDSALL	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	63	63	0	2.43	2
Backlick Run	001102SMH	X	841	S PICKETT ST	Light Highway Rural Streets	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	62	63	0	0	2
Backlick Run	001112SMH	X	555	S VAN DORN ST	Driveway	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	62	62	0	2.43	3
Backlick Run	001161SMH	X	5261	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	62	62	0	2.43	3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	004029IN	X	450	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	62	63	0	2.43	3
Backlick Run	004340IN	X	200	S WHITING ST	Yard-Back	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	62	63	0	2.43	3
Backlick Run	001109SMH	X	726	S PICKETT ST	Sidewalk	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	61	61	0	2.43	4
Backlick Run	001440SMH	X	400	S WHITING ST	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	61	62	0	2.43	4
Backlick Run	004344IN	X	6161	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	61	61	0	1.35	3
Backlick Run	001013SMH	X	5860	FARRINGTON AV	Sidewalk	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	60	58	5	1.35	3
Backlick Run	003077IN	X	557	S VAN DORN ST	Sidewalk	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	60	58	5	2.43	4
Backlick Run	000731SMH	X	4951	BRENMAN PARK DR	Light Highway Rural Streets	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	59	60	0	1.5	4
Backlick Run	001025SMH	X	530	CAMERON STATION BV	Easement	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	59	61	0	0	3
Backlick Run	001034SMH	X	700	S PICKETT ST	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	59	60	0	1.35	4
Backlick Run	001136SMH	X	400	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	59	60	0	2.43	4
Backlick Run	001145SMH	X	5001	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	59	60	0	2.43	3
Backlick Run	001165SMH	X	5261	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	59	60	0	2.43	2
Backlick Run	001297SMH	X	5255	COLONEL JOHNSON LA	Light Highway Rural Streets	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	59	61	0	2.43	2
Backlick Run	001778SMH	X	211	YOAKUM PY	Driveway	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	59	61	0	2.43	3
Backlick Run	001783SMH	X	6000	EDSALL RD	Parking Lot	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	59	60	0	1.35	5
Backlick Run	003051IN	X	840	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	59	59	0	2.43	2
Backlick Run	004048IN	X	499	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	59	60	0	2.43	3
Backlick Run	001299SMH	X	349	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	58	60	0	2.43	4
Backlick Run	004369IN	X	400	S VAN DORN ST	Easement	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	58	59	0	2.43	3
Backlick Run	005083IN	X	400	YOAKUM PY	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	58	58	0	2.43	3
Backlick Run	001103SMH	X	950	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	57	58	0	2.43	3
Backlick Run	001140SMH	X	366	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	57	57	5	2.43	3
Backlick Run	001316SMH	X	270	S REYNOLDS ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	57	58	0	2.43	2
Backlick Run	003053IN	X	880	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	57	58	0	0	4
Backlick Run	003057IN	X	950	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	57	58	0	1.35	2
Backlick Run	003063IN	X	841	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	57	58	0	2.43	3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	003117IN	X	701	S VAN DORN ST	Curb/Gutter	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	57	58	0	2.43	3
Backlick Run	003567IN	X	5200	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	57	58	0	1.35	3
Backlick Run	004140IN	X	85	S BRAGG ST	Sidewalk	<a href="#">02/13/2013</a>	Truck 1	Complete Inspection	57	50	30	0	3
Backlick Run	000746SMH	X	4800	BRENNAN PARK DR	Light Highway Rural Streets	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	56	57	0	1.35	4
Backlick Run	001018SMH	X	5860	FARRINGTON AV	Light Highway Rural Streets	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	56	57	0	1.35	3
Backlick Run	001022SMH	X	5859	FARRINGTON AV	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	2
Backlick Run	001023SMH	X	511	S VAN DORN ST	Light Highway Rural Streets	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	56	57	0	1.35	4
Backlick Run	001030SMH	X	557	S VAN DORN ST	Light Highway Rural Streets	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	56	57	0	0	2
Backlick Run	001031SMH	X	700	S PICKETT ST	Light Highway Rural Streets	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	56	57	0	0	3
Backlick Run	001098SMH	X	820	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	56	57	0	1.35	3
Backlick Run	001111SMH	X	557	S VAN DORN ST	Light Highway Rural Streets	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	56	57	0	0	4
Backlick Run	001142SMH	X	519	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	56	57	0	1.35	2
Backlick Run	001168SMH	X	5301	EISENHOWER AV	Parking Lot	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	2
Backlick Run	001295SMH	X	335	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001296SMH	X	5255	COLONEL JOHNSON LA	Light Highway Rural Streets	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001300SMH	X	336	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001303SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	4
Backlick Run	001307SMH	X	300	S PICKETT ST	Light Highway Rural Streets	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001310SMH	X	106	MARTIN LA	Light Highway Rural Streets	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	56	57	0	1.5	4
Backlick Run	001318SMH	X	240	S REYNOLDS ST	Yard-Side	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	56	57	0	0	3
Backlick Run	001319SMH	X	240	S REYNOLDS ST	Parking Lot	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001337SMH	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	4
Backlick Run	001361SMH	X	6301	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	56	57	0	1.35	4
Backlick Run	001363SMH	X	6301	STEVENSON AV	Driveway	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	56	57	0	1.35	4
Backlick Run	001367SMH	X	200	YOAKUM PY	Light Highway Rural Streets	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	56	57	0	1.35	3
Backlick Run	001368SMH	X	6300	STEVENSON AV	Light Highway Rural Streets	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	56	57	0	1.35	4
Backlick Run	001369SMH	X	6300	STEVENSON AV	Light Highway Rural Streets	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	001374SMH	X	6301	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	2
Backlick Run	001430SMH	X	266	N STEVENSON SQ	Sidewalk	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001432SMH	X	400	S WHITING ST	Easement	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001437SMH	X	400	S WHITING ST	Yard-Front	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001438SMH	X	400	S WHITING ST	Light Highway Rural Streets	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	56	57	0	1.35	3
Backlick Run	001441SMH	X	5901	EDSALL RD	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001449SMH	X	6000	EDSALL RD	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	56	57	0	1.35	3
Backlick Run	001746SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	2
Backlick Run	001748SMH	X	320	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001751SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	2
Backlick Run	001752SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	001755SMH	X	423	S REYNOLDS ST	Light Highway Rural Streets	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	4
Backlick Run	001756SMH	X	611	S PICKETT ST	Parking Lot	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	2
Backlick Run	001758SMH	X	333	S REYNOLDS ST	Light Highway Rural Streets	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	56	57	0	2.16	3
Backlick Run	001768SMH	X	211	YOAKUM PY	Light Highway Rural Streets	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	3
Backlick Run	002162IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	56	38	35	2.43	3
Backlick Run	003515IN	X	4900	EISENHOWER AV	Parking Lot	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	56	57	0	0	3
Backlick Run	003543IN	X	5001	EISENHOWER AV	Parking Lot	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	56	56	0	1.35	1
Backlick Run	003602IN	X	4926	EISENHOWER AV	Parking Lot	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	56	56	0	1.35	2
Backlick Run	004009IN	X	349	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	2
Backlick Run	004934SMH	X	519	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	56	57	0	2.43	4
Backlick Run	005055IN	X	5703	EDSALL RD	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	56	56	0	2.43	3
Backlick Run	005057IN	X	333	S REYNOLDS ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	56	56	0	1.35	3
Backlick Run	001442SMH	X	400	S WHITING ST	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	55	56	0	1.35	2
Backlick Run	005084IN	X	300	YOAKUM PY	Easement	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	55	51	15	2.43	2
Backlick Run	001021SMH	X	5700	EISENHOWER AV	Sidewalk	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	54	55	0	2.43	2
Backlick Run	001099SMH	X	841	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	54	55	0	2.43	2

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	001124SMH	X	400	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	54	55	0	2.43	4
Backlick Run	001144SMH	X	5001	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	54	55	0	2.43	3
Backlick Run	001157SMH	X	5200	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	54	55	0	2.43	2
Backlick Run	001750SMH	X	300	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	54	55	0	1.35	3
Backlick Run	001757SMH	X	333	S REYNOLDS ST	Light Highway Rural Streets	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	54	55	0	2.43	3
Backlick Run	001375SMH	X	6301	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	53	54	0	1.35	2
Backlick Run	004035IN	X	401	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	53	53	0	2.43	3
Backlick Run	001121SMH	X	519	CAMERON STATION BV	Yard-Side	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	52	50	15	2.43	2
Backlick Run	001429SMH	X	6300	STEVENSON AV	Light Highway Rural Streets	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	52	51	5	1.35	3
Backlick Run	002155IN	X	4901	DUKE ST	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	52	52	0	1.5	3
Backlick Run	003554SMH	X		EDSALL	Parking Lot	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	52	53	0	2.43	4
Backlick Run	001131SMH	X	444	FERDINAND DAY DR	Light Highway Rural Streets	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	51	52	0	2.43	3
Backlick Run	001132SMH	X	424	FERDINAND DAY DR	Light Highway Rural Streets	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	51	52	0	2.43	2
Backlick Run	001291SMH	X	106	MARTIN LA	Light Highway Rural Streets	<a href="#">02/21/2013</a>	Truck 1	Complete Inspection	51	52	0	2.43	4
Backlick Run	001292SMH	X	106	MARTIN LA	Light Highway Rural Streets	<a href="#">02/21/2013</a>	Truck 1	Complete Inspection	51	52	0	2.43	2
Backlick Run	001294SMH	X	106	MARTIN LA	Light Highway Rural Streets	<a href="#">02/21/2013</a>	Truck 1	Complete Inspection	51	52	0	2.43	3
Backlick Run	001349SMH	X	200	S WHITING ST	Yard-Side	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	51	52	0	1.35	2
Backlick Run	001760SMH	X	423	S REYNOLDS ST	Parking Lot	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	51	52	0	2.16	2
Backlick Run	003085IN	X	555	S VAN DORN ST	Sidewalk	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	51	52	0	2.43	2
Backlick Run	003459IN	X	450	FERDINAND DAY DR	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	51	52	0	2.43	2
Backlick Run	003587IN	X	5301	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	51	52	0	2.43	2
Backlick Run	004352IN	X	450	YOAKUM PY	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	51	52	0	2.43	2
Backlick Run	001298SMH	X	349	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	50	50	0	2.43	3
Backlick Run	001372SMH	X	6301	STEVENSON AV	Sidewalk	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	50	51	0	2.43	2
Backlick Run	001393SMH	X	27	S BRAGG ST	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	50	51	0	1.35	3
Backlick Run	001394SMH	X	27	S BRAGG ST	Light Highway Rural Streets	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	50	51	0	1.35	2
Backlick Run	001395SMH	X	27	S BRAGG ST	Light Highway Rural Streets	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	50	51	0	2.43	3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	001426SMH	X	27	S BRAGG ST	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	50	51	0	2.43	2
Backlick Run	001427SMH	X	27	S BRAGG ST	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	50	51	0	2.43	2
Backlick Run	001779SMH	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	50	50	0	2.43	3
Backlick Run	003100IN	X	611	S PICKETT ST	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	50	50	0	2.43	2
Backlick Run	003379IN	X	5902	FARRINGTON AV	Paved Asphalt	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	50	50	0	2.43	3
Backlick Run	003428IN	X	433	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	50	51	0	2.43	3
Backlick Run	003429IN	X	433	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	50	51	0	0	3
Backlick Run	003573IN	X	5200	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	50	50	0	0	3
Backlick Run	004050IN	X	399	S PICKETT ST	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	50	50	0	2.43	3
Backlick Run	004080IN	X	300	S PICKETT ST	Parking Lot	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	50	50	0	2.43	2
Backlick Run	004081IN	X	300	S PICKETT ST	Parking Lot	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	50	50	0	2.43	2
Backlick Run	004138IN	X	99	S BRAGG ST	Yard-Back	<a href="#">02/13/2013</a>	Truck 1	Complete Inspection	50	51	0	1.5	3
Backlick Run	004139IN	X	99	S BRAGG ST	Sidewalk	<a href="#">02/13/2013</a>	Truck 1	Complete Inspection	50	51	0	2.43	4
Backlick Run	004226SMH	X		JOHN TICER	Light Highway Rural Streets	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	50	51	0	2.43	2
Backlick Run	004234SMH	X		WOODLAND	Parking Lot	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	50	50	0	2.43	2
Backlick Run	001754SMH	X	5660	EDSALL RD	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	49	49	0	2.43	3
Backlick Run	001763SMH	X	240	YOAKUM PY	Easement	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	49	49	0	2.43	4
Backlick Run	001767SMH	X	211	YOAKUM PY	Driveway	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	49	50	0	2.43	3
Backlick Run	000730SMH	X	4800	BRENMAN PARK DR	Light Highway Rural Streets	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	48	49	0	2.43	2
Backlick Run	000732SMH	X	4951	BRENMAN PARK DR	Light Highway Rural Streets	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	48	49	0	1.5	4
Backlick Run	001135SMH	X	400	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	4
Backlick Run	001138SMH	X	391	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	2
Backlick Run	001143SMH	X	350	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	48	14	35	2.43	3
Backlick Run	001166SMH	X	5263	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	5
Backlick Run	001167SMH	X	5301	EISENHOWER AV	Parking Lot	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	48	49	0	0	3
Backlick Run	001286SMH	X	106	MARTIN LA	Brick	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	2
Backlick Run	001293SMH	X	230	MURTHA ST	Light Highway Rural Streets	<a href="#">02/21/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	001311SMH	X	4951	BRENMAN PARK DR	Light Highway Rural Streets	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	3
Backlick Run	003069IN	X	620	BURNSIDE PL	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	48	49	0	1.35	2
Backlick Run	003105IN	X	550	S PICKETT ST	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	48	45	2	2.43	2
Backlick Run	003485IN	X	4926	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	3
Backlick Run	004049IN	X	401	S PICKETT ST	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	48	45	2	2.16	3
Backlick Run	004230SMH	X		EISENHOWER	Parking Lot	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	4
Backlick Run	004231SMH	X		EISENHOWER	Parking Lot	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	3
Backlick Run	004232SMH	X		EISENHOWER	Parking Lot	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	3
Backlick Run	004287IN	X	6301	STEVENSON AV	Sidewalk	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	48	49	0	2.43	3
Backlick Run	001100SMH	X	840	S PICKETT ST	Yard-Front	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	47	48	0	2.43	3
Backlick Run	001314SMH	X	300	S PICKETT ST	Parking Lot	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	47	48	0	2.43	2
Backlick Run	001320SMH	X	240	S REYNOLDS ST	Easement	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	47	48	0	2.43	2
Backlick Run	001017SMH	X	5860	FARRINGTON AV	Light Highway Rural Streets	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	46	46	0	2.43	3
Backlick Run	001126SMH	X	435	FERDINAND DAY DR	Light Highway Rural Streets	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	46	46	0	1.35	2
Backlick Run	001765SMH	X	611	S PICKETT ST	Light Highway Rural Streets	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	46	46	0	2.43	2
Backlick Run	005106IN	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	46	46	0	2.43	3
Backlick Run	001123SMH	X	400	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	45	46	0	2.43	4
Backlick Run	001128SMH	X	435	FERDINAND DAY DR	Light Highway Rural Streets	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	45	46	0	1.5	4
Backlick Run	001288SMH	X	4950	BRENMAN PARK DR	Light Highway Rural Streets	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	45	46	0	1.5	2
Backlick Run	001439SMH	X	400	S WHITING ST	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	45	46	0	2.43	4
Backlick Run	001450SMH	X	6000	EDSALL RD	Yard-Front	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	45	46	0	2.43	2
Backlick Run	003118IN	X	701	S VAN DORN ST	Light Highway Rural Streets	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	45	38	10	2.43	3
Backlick Run	003481IN	X	320	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	45	46	0	2.43	3
Backlick Run	004005IN	X	5255	COLONEL JOHNSON LA	Sidewalk	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	45	46	0	1.35	3
Backlick Run	001159SMH	X	5200	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	44	45	0	0	3
Backlick Run	001290SMH	X	106	MARTIN LA	Light Highway Rural Streets	<a href="#">02/21/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	3
Backlick Run	003041IN	X	821	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	003047IN	X	841	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	44	45	0	1.5	3
Backlick Run	003058IN	X	841	S PICKETT ST	Parking Lot	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	44	45	0	1.35	3
Backlick Run	003064IN	X	950	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2
Backlick Run	003075IN	X	628	S PICKETT ST	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2
Backlick Run	003082IN	X	700	S PICKETT ST	Sidewalk	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	4
Backlick Run	003101IN	X	611	S PICKETT ST	Parking Lot	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2
Backlick Run	003132IN	X	623	S PICKETT ST	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2
Backlick Run	003457IN	X	444	FERDINAND DAY DR	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2
Backlick Run	003461IN	X	450	FERDINAND DAY DR	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2
Backlick Run	003537IN	X	5001	EISENHOWER AV	Parking Lot	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	4
Backlick Run	003546IN	X	5001	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	44	45	0	1.35	2
Backlick Run	003990IN	X	106	MARTIN LA	Yard-Side	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2
Backlick Run	004082IN	X	300	S PICKETT ST	Parking Lot	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	4
Backlick Run	004096IN	X	301	S REYNOLDS ST	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	44	45	0	0	3
Backlick Run	004098IN	X	250	S REYNOLDS ST	Easement	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2
Backlick Run	004100IN	X	401	S PICKETT ST	Easement	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	44	45	0	1.35	2
Backlick Run	004351IN	X	450	YOAKUM PY	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	3
Backlick Run	004353IN	X	450	YOAKUM PY	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2
Backlick Run	004370IN	X	400	S VAN DORN ST	Easement	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	44	45	0	0	3
Backlick Run	004392IN	X	201	S VAN DORN ST	Sidewalk	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	2
Backlick Run	004396IN	X	400	S WHITING ST	Easement	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	44	45	0	2.43	3
Backlick Run	004402IN	X	400	S WHITING ST	Sidewalk	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	44	45	0	1.35	2
Backlick Run	005087IN	X	6135	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	44	45	0	1.35	3
Backlick Run	003054IN	X	841	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	43	38	15	2.43	3
Backlick Run	004010IN	X	349	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	43	38	15	2.43	3
Backlick Run	000007CD	X		EISENHOWER	Easement	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	42	38	10	1.5	2
Backlick Run	001308SMH	X	401	S PICKETT ST	Easement	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	42	43	0	2.43	3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	002153IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	42	42	0	2.43	3
Backlick Run	003120IN	X	5860	FARRINGTON AV	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	42	26	25	2.43	2
Backlick Run	003488IN	X	5001	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	42	38	5	2.43	2
Backlick Run	003500IN	X	5001	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	42	43	0	2.43	1
Backlick Run	003514IN	X	4900	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	42	42	0	1.5	3
Backlick Run	003601IN	X	5380	EISENHOWER AV	Parking Lot	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	42	43	0	1.35	3
Backlick Run	004143IN	X	85	S BRAGG ST	Sidewalk	<a href="#">02/13/2013</a>	Truck 1	Complete Inspection	42	42	0	2.43	2
Backlick Run	004373IN	X	400	S VAN DORN ST	Easement	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	42	42	0	2.16	4
Backlick Run	004397IN	X	400	S WHITING ST	Parking Lot	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	42	42	0	2.43	2
Backlick Run	005073IN	X	211	YOAKUM PY	Sidewalk	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	42	42	0	2.43	2
Backlick Run	005082IN	X	211	YOAKUM PY	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	42	43	0	2.43	3
Backlick Run	001133SMH	X	416	FERDINAND DAY DR	Light Highway Rural Streets	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	41	42	0	2.43	2
Backlick Run	001134SMH	X	450	FERDINAND DAY DR	Light Highway Rural Streets	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	41	42	0	1.35	3
Backlick Run	001148SMH	X	4840	EISENHOWER AV	Light Highway Rural Streets	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	41	41	0	1.35	2
Backlick Run	001285SMH	X	151	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	41	41	0	1.5	3
Backlick Run	004085SMH	X		CAMERON STATION	Curb/Gutter	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	41	42	0	1.5	2
Backlick Run	004088IN	X	270	S REYNOLDS ST	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	41	38	2	2.43	2
Backlick Run	004090IN	X	240	S REYNOLDS ST	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	41	38	2	2.43	3
Backlick Run	004104SMH	X		YOAKUM	Driveway	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	40	40	0	1.35	4
Backlick Run	001770SMH	X	300	YOAKUM PY	Easement	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	38	39	0	2.43	5
Backlick Run	001773SMH	X	6200	EDSALL RD	Yard-Front	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	38	39	0	1.35	3
Backlick Run	003478IN	X	5229	TANCRETI LA	Sidewalk	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	38	29	15	2.43	2
Backlick Run	001101SMH	X	840	S PICKETT ST	Yard-Front	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	001119SMH	X	520	CAMERON STATION BV	Easement	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	001335SMH	X	99	S BRAGG ST	Parking Lot	<a href="#">02/13/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	001364SMH	X	6300	STEVENSON AV	Main Highway Suburban	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	4
Backlick Run	001431SMH	X	505	S VAN DORN ST	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	4

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	001761SMH	X	201	S VAN DORN ST	Parking Lot	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	002140IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	002143IN	X	230	MURTHA ST	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	002160IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	002164IN	X	4901	DUKE ST	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	002177IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	002185IN	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	37	38	0	2.43	4
Backlick Run	002190IN	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	003043IN	X	800	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	003065IN	X	619	BURNSIDE PL	Easement	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	003094IN	X	511	S VAN DORN ST	Sidewalk	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	003095IN	X	511	S VAN DORN ST	Sidewalk	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	4
Backlick Run	003403IN	X	5700	EISENHOWER AV	Sidewalk	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	2
Backlick Run	003420IN	X	520	CAMERON STATION BV	Easement	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	4
Backlick Run	003427IN	X	520	CAMERON STATION BV	Easement	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	003439IN	X	519	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	003443IN	X	433	CAMERON STATION BV	Sidewalk	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	003464IN	X	400	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	003475IN	X	519	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	003486IN	X	4926	EISENHOWER AV	Parking Lot	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	003490IN	X	5001	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	003494IN	X	5001	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	1
Backlick Run	003508IN	X	5001	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	2
Backlick Run	003511IN	X	5001	EISENHOWER AV	Parking Lot	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	3
Backlick Run	003534IN	X	5001	EISENHOWER AV	Parking Lot	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	1
Backlick Run	003547IN	X	4840	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	37	38	0	0	4
Backlick Run	003549IN	X	4840	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	37	38	0	1.5	2

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	003578IN	X	5249	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	2
Backlick Run	003589IN	X	5601	EISENHOWER AV	Sidewalk	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	37	38	0	1.5	4
Backlick Run	003597IN	X	5400	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	003983IN	X	151	CAMERON STATION BV	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	2
Backlick Run	003989IN	X	106	MARTIN LA	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	003991IN	X	106	MARTIN LA	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	003992IN	X	195	CAMERON STATION BV	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	004002IN	X	335	CAMERON STATION BV	Sidewalk	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	004015IN	X	245	CAMERON STATION BV	Sidewalk	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	004051IN	X	4950	BRENMAN PARK DR	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	37	38	0	1.5	2
Backlick Run	004083IN	X	550	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	2
Backlick Run	004086IN	X	611	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	004097IN	X	301	S REYNOLDS ST	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	37	38	0	0	3
Backlick Run	004099IN	X	260	S REYNOLDS ST	Easement	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	4
Backlick Run	004105IN	X	400	S VAN DORN ST	Parking Lot	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	37	38	0	0	3
Backlick Run	004123IN	X	110	S BRAGG ST	Parking Lot	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	004136IN	X	6300	STEVENSON AV	Sidewalk	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	004288IN	X	6125	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	2
Backlick Run	004341IN	X	110	S BRAGG ST	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	004398IN	X	400	S WHITING ST	Driveway	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	005056IN	X	611	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	005058IN	X	423	S REYNOLDS ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	005059IN	X	423	S REYNOLDS ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	005092IN	X	6200	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	3
Backlick Run	005093IN	X	6200	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	37	38	0	1.35	3
Backlick Run	005107IN	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	37	38	0	2.43	2
Backlick Run	001302SMH	X	245	CAMERON STATION BV	Sidewalk	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	36	36	0	2.43	2

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	001317SMH	X	270	S REYNOLDS ST	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	36	36	0	2.43	2
Backlick Run	005060IN	X	423	S REYNOLDS ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	36	15	25	2.43	2
Backlick Run	001315SMH	X	450	S PICKETT ST	Parking Lot	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	30	30	0	2.43	4
Backlick Run	000724SMH	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	29	29	0	1.35	2
Backlick Run	000725SMH	X	230	MURTHA ST	Light Highway Rural Streets	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	29	29	0	2.43	2
Backlick Run	000727SMH	X	4800	BRENMAN PARK DR	Light Highway Rural Streets	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	29	29	0	2.43	3
Backlick Run	001147SMH	X	4840	EISENHOWER AV	Yard-Front	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	29	29	0	2.43	3
Backlick Run	001301SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	29	29	0	2.43	3
Backlick Run	004108SMH	X		EDSALL	Light Highway Rural Streets	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	29	29	0	1.35	2
Backlick Run	001170SMH	X	5300	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	28	29	0	2.43	2
Backlick Run	001313SMH	X	300	S PICKETT ST	Parking Lot	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	28	29	0	2.43	2
Backlick Run	001759SMH	X	423	S REYNOLDS ST	Yard-Front	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	28	29	0	2.43	2
Backlick Run	003452IN	X	435	FERDINAND DAY DR	Sidewalk	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	28	29	0	2.43	3
Backlick Run	004144IN	X	85	S BRAGG ST	Sidewalk	<a href="#">02/13/2013</a>	Truck 1	Complete Inspection	28	29	0	1.5	3
Backlick Run	003441IN	X	433	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	26	26	0	2.43	2
Backlick Run	002159IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	22	22	0	1.5	3
Backlick Run	001014SMH	X	5859	FARRINGTON AV	Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	18	19	0	0	4
Backlick Run	001020SMH	X	5700	EISENHOWER AV	Easement	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	18	19	0	2.43	3
Backlick Run	001141SMH	X	519	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	18	19	0	2.43	3
Backlick Run	005045IN	X	245	CAMERON STATION BV	Sidewalk	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	18	0	19	2.43	2
Backlick Run	001113SMH	X	555	S VAN DORN ST	Easement	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	15	15	0	2.43	2
Backlick Run	001338SMH	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	15	15	0	2.43	2
Backlick Run	001425SMH	X	27	S BRAGG ST	Sidewalk	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	15	15	0	2.43	2
Backlick Run	003477IN	X	320	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	15	0	15	2.16	2
Backlick Run	000723SMH	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	14	14	0	1.35	3
Backlick Run	001026SMH	X	530	CAMERON STATION BV	Easement	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	14	14	0	2.43	3
Backlick Run	002169IN	X	4901	DUKE ST	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	14	14	0	2.43	3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	000284IO	X	6325	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	10	10	0	2.43	1
Backlick Run	000605IO	X	99	S BRAGG ST	Easement	<a href="#">02/14/2013</a>	Truck 1	Complete Inspection	10	10	0	2.43	1
Backlick Run	003123IN	X	1		Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	10	10	0	2.43	3
Backlick Run	005044IN	X	245	CAMERON STATION BV	Sidewalk	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	9	0	10	2.43	2
Backlick Run	000043CP	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000044CP	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000055CP	X	731	S PICKETT ST	Easement	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000056CP	X	800	S PICKETT ST	Easement	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	1
Backlick Run	000057CP	X	700	S. PICKETT	Easement	<a href="#">02/14/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000058CP	X	660	S. PICKETT	Easement	<a href="#">02/14/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000068CP	X	6060	TOWER CT	Easement	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	1
Backlick Run	000156IO	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	0	0	0	1.35	1
Backlick Run	000158IO	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	0	0	0	1.35	1
Backlick Run	000213IO	X	628	S PICKETT ST	Easement	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000215IO	X	520	CAMERON STATION BV	Easement	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	1
Backlick Run	000216IO	X	840	S PICKETT ST	Easement	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000220CP	X		Van Dorn		<a href="#">06/05/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	1
Backlick Run	000221CP	X		Van Dorn		<a href="#">06/05/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000221IO	X	530	CAMERON STATION BV	Easement	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000222CP	X		Van Dorn		<a href="#">06/05/2013</a>	Truck 1	Complete Inspection	0	0	0	0	1
Backlick Run	000222IO	X	5101	EISENHOWER AV	Easement	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000223CP	X		Van Dorn		<a href="#">06/05/2013</a>	Truck 1	Complete Inspection	0	0	0	0	1
Backlick Run	000223IO	X	5001	EISENHOWER AVE	Easement	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	1
Backlick Run	000224CP	X		Van Dorn		<a href="#">06/05/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	1
Backlick Run	000225CP	X		Van Dorn		<a href="#">06/05/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000225IO	X	5001	EISENHOWER AVE	Easement	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	0	0	0	0	1
Backlick Run	000226CP	X		Van Dorn		<a href="#">06/05/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	000227CP	X		Van Dorn		<a href="#">06/05/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	1
Backlick Run	000229CP	X		BRAGG	Easement	<a href="#">02/14/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000231IO	X	5281	EISENHOWER AV	Easement	<a href="#">01/28/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000279IO	X	550	S PICKETT ST	Easement	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000283IO	X	6301	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	1
Backlick Run	000286IO	X	200	S WHITING ST	Easement	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000296IO	X	110	S BRAGG ST	Easement	<a href="#">02/06/2013</a>	Truck 1	Complete Inspection	0	0	0	1.5	1
Backlick Run	000348IO	X	350	YOAKUM PY	Easement	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000364ND	X	520	S VAN DORN ST		<a href="#">03/15/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000377ND	X	620	BURNSIDE PL		<a href="#">02/05/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	1.35	0
Backlick Run	000378ND	X		VAN DORN		<a href="#">03/14/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	1.35	0
Backlick Run	000383ND	X	5255	COLONEL JOHNSON LA		<a href="#">01/17/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000403ND	X	5860	FARRINGTON AV		<a href="#">03/15/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000408ND	X		VAN DORN		<a href="#">03/07/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000409ND	X		VAN DORN		<a href="#">03/07/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	1.35	0
Backlick Run	000411ND	X	5860	FARRINGTON AV		<a href="#">03/14/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	1.35	0
Backlick Run	000421ND	X		TANCRETI		<a href="#">01/17/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000422ND	X	520	CAMERON STATION BV		<a href="#">01/24/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	0	0
Backlick Run	000449ND	X	5601	EISENHOWER AV		<a href="#">03/14/2013</a>	Truck 1	Not Inspected - Not found	0	0	0	2.43	0
Backlick Run	000450ND	X	5261	EISENHOWER AV	Parking Lot	<a href="#">01/28/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000451ND	X	5261	EISENHOWER AV	Parking Lot	<a href="#">01/28/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000505ND	X	230	MURTHA ST		<a href="#">02/21/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000519ND	X	5255	COLONEL JOHNSON LA		<a href="#">01/17/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000555ND	X	6025	TOWER CT		<a href="#">03/14/2013</a>	Truck 1	Not Inspected - Not found	0	0	0	2.43	0
Backlick Run	000608IO	X	6000	EDSALL	Easement	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000609IO	X				<a href="#">07/16/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	000668ND	X	240	YOAKUM PY		<a href="#">03/11/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	1.35	0

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	000675ND	X	211	YOAKUM PY		<a href="#">03/11/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000676ND	X	240	YOAKUM PY		<a href="#">03/11/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000677ND	X	6000	EDSALL RD		<a href="#">03/14/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	0
Backlick Run	000678ND	X	240	YOAKUM PY		<a href="#">03/11/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	1.35	0
Backlick Run	000722SMH	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	0	0	0	1.35	2
Backlick Run	000726SMH	X	4800	BRENMAN PARK DR	Light Highway Rural Streets	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	001019SMH	X	1		Light Highway Rural Streets	<a href="#">03/14/2013</a>	Truck 1	Complete Inspection	0	0	0	1.5	4
Backlick Run	001035SMH	X	1		Easement	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	4
Backlick Run	001036SMH	X	1		Yard-Back	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	001037SMH	X	1		Yard-Back	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	001038SMH	X	1		Yard-Back	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	001114SMH	X	555	S VAN DORN ST	Easement	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	4
Backlick Run	001122SMH	X	530	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	001146SMH	X	4900	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	001304SMH	X	320	CAMERON STATION BV	Yard-Front	<a href="#">01/15/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	001329SMH	X	6300	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	001350SMH	X	200	S WHITING ST	Yard-Side	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	001351SMH	X	200	S WHITING ST	Yard-Side	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	2
Backlick Run	001447SMH	X	6161	EDSALL RD		<a href="#">03/13/2013</a>	Truck 1	Not Inspected - Not found	0	0	0	2.43	0
Backlick Run	001448SMH	X	6161	EDSALL RD		<a href="#">03/13/2013</a>	Truck 1	Not Inspected - Not found	0	0	0	2.43	0
Backlick Run	001771SMH	X	6135	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	001774SMH	X	6200	EDSALL RD	Yard-Front	<a href="#">03/13/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	3
Backlick Run	001780SMH	X	211	YOAKUM PY		<a href="#">03/11/2013</a>	Truck 1	Not Inspected - Not found	0	0	0	2.43	0
Backlick Run	001781SMH	X	211	YOAKUM PY		<a href="#">03/13/2013</a>	Truck 1	Not Inspected - Not found	0	0	0	1.5	0
Backlick Run	001782SMH	X	211	YOAKUM PY		<a href="#">03/13/2013</a>	Truck 1	Not Inspected - Not found	0	0	0	1.35	0
Backlick Run	002137IN	X	5131	BRAWNER PL	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	002175IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	0	0	0	2.43	3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Backlick Run	002189IN	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	002252ND	X		CAMERON STATION		<a href="#">01/28/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	1.35	0
Backlick Run	002256ND	X		REYNOLDS		<a href="#">01/24/2013</a>	Truck 1	Not Inspected - Not found	0	0	0	1.35	0
Backlick Run	003045IN	X	841	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	0
Backlick Run	003121IN	X	1		Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	003122IN	X	1		Sidewalk	<a href="#">02/05/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	003382IN	X	5902	FARRINGTON AV		<a href="#">03/14/2013</a>	Truck 1	Not Inspected - Not Opened	0	0	0	0	0
Backlick Run	003402IN	X	1		Sidewalk	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	003404IN	X	5700	EISENHOWER AV	Sidewalk	<a href="#">03/07/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	003425IN	X	520	CAMERON STATION BV	Easement	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	003426IN	X	520	CAMERON STATION BV	Easement	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	003432IN	X	433	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	003436IN	X	519	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	003442IN	X	519	CAMERON STATION BV	Sidewalk	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	003453IN	X	435	FERDINAND DAY DR	Sidewalk	<a href="#">02/11/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	003499IN	X	5001	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	2.43	4
Backlick Run	003551IN	X	4840	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	2
Backlick Run	003997IN	X	106	MARTIN LA	Sidewalk	<a href="#">02/21/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	003998IN	X	106	MARTIN LA	Sidewalk	<a href="#">02/21/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	004008IN	X	357	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	004022IN	X	300	S PICKETT ST		<a href="#">03/06/2013</a>	Truck 1	Not Inspected - Not Opened	0	0	0	2.43	0
Backlick Run	004032IN	X	499	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	004047IN	X	519	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	004137IN	X	6300	STEVENSON AV	Sidewalk	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	2
Backlick Run	004338IN	X	200	S WHITING ST	Yard-Back	<a href="#">03/06/2013</a>	Truck 1	Complete Inspection	0	0	0	2.43	1
Backlick Run	004354IN	X	6000	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	Truck 1	Not Inspected - No Access	0	0	0	0	0
Backlick Run	004357IN	X	400	S WHITING ST	Easement	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	0	0	0	1.35	2

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connectin g Pipes
Backlick Run	004400IN	X	400	S WHITING ST	Sidewalk	<a href="#">03/15/2013</a>	Truck 1	Complete Inspection	0	0	0	0	2
Backlick Run	004933SMH	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	Truck 1	Complete Inspection	0	0	0	2.43	3
Backlick Run	005074IN	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	Truck 1	Complete Inspection	0	0	0	0	2



**Appendix B – Structure Inspection Report**  
**(Includes Defect Detail)**



# SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Facility ID

## Alexandria - Backlick Run

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	000007CD	X		EISENHOWER	Easement	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		42	38	10	1.5	2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Pipe Connection-1	Roots Intrusion	Min: ~1/16" to 1/8" (2-3mm) dia., fingers, small mass			Maintenance					
Backlick Run	000043CP	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000044CP	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000055CP	X	731	S PICKETT ST	Easement	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000056CP	X	800	S PICKETT ST	Easement	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		0	0	0	1.35	1
Backlick Run	000057CP	X	700	S. PICKETT	Easement	<a href="#">02/14/2013</a>	<a href="#">02/14/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000058CP	X	660	S. PICKETT	Easement	<a href="#">02/14/2013</a>	<a href="#">02/14/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000068CP	X	6060	TOWER CT	Easement	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		0	0	0	1.35	1
Backlick Run	000156IO	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		0	0	0	1.35	1
Backlick Run	000158IO	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		0	0	0	1.35	1
Backlick Run	000213IO	X	628	S PICKETT ST	Easement	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000215IO	X	520	CAMERON STATION BV	Easement	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		0	0	0	1.35	1
Backlick Run	000216IO	X	840	S PICKETT ST	Easement	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000220CP	X		Van Dorn		<a href="#">06/05/2013</a>	<a href="#">06/05/2013</a>	Truck 1	1		0	0	0	1.35	1
Backlick Run	000221CP	X		Van Dorn		<a href="#">06/05/2013</a>	<a href="#">06/05/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000221IO	X	530	CAMERON STATION BV	Easement	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000222CP	X		Van Dorn		<a href="#">06/05/2013</a>	<a href="#">06/05/2013</a>	Truck 1	1		0	0	0	0	1
Backlick Run	000222IO	X	5101	EISENHOWER AV	Easement	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000223CP	X		Van Dorn		<a href="#">06/05/2013</a>	<a href="#">06/05/2013</a>	Truck 1	1		0	0	0	0	1
Backlick Run	000223IO	X	5001	EISENHOWER AVE	Easement	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		0	0	0	1.35	1
Backlick Run	000224CP	X		Van Dorn		<a href="#">06/05/2013</a>	<a href="#">06/05/2013</a>	Truck 1	1		0	0	0	1.35	1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	000225CP	X		Van Dorn		<a href="#">06/05/2013</a>	<a href="#">06/05/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000225IO	X	5001	EISENHOWER AVE	Easement	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		0	0	0	0	1
Backlick Run	000226CP	X		Van Dorn		<a href="#">06/05/2013</a>	<a href="#">06/05/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000227CP	X		Van Dorn		<a href="#">06/05/2013</a>	<a href="#">06/05/2013</a>	Truck 1	1		0	0	0	1.35	1
Backlick Run	000229CP	X		BRAGG	Easement	<a href="#">02/14/2013</a>	<a href="#">02/14/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000231IO	X	5281	EISENHOWER AV	Easement	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000279IO	X	550	S PICKETT ST	Easement	<a href="#">03/05/2013</a>	<a href="#">03/05/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000283IO	X	6301	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		0	0	0	1.35	1
Backlick Run	000284IO	X	6325	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		10	10	0	2.43	1
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	000286IO	X	200	S WHITING ST	Easement	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000296IO	X	110	S BRAGG ST	Easement	<a href="#">02/06/2013</a>	<a href="#">02/06/2013</a>	Truck 1	1		0	0	0	1.5	1
Backlick Run	000348IO	X	350	YOAKUM PY	Easement	<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000364ND	X	520	S VAN DORN ST		<a href="#">03/15/2013</a>	<a href="#">03/15/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000377ND	X	620	BURNSIDE PL		<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1	No Access	0	0	0	1.35	0
Backlick Run	000378ND	X		VAN DORN		<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1	No Access	0	0	0	1.35	0
Backlick Run	000383ND	X	5255	COLONEL JOHNSON LA		<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000403ND	X	5860	FARRINGTON AV		<a href="#">03/15/2013</a>	<a href="#">03/15/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000408ND	X		VAN DORN		<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000409ND	X		VAN DORN		<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1	No Access	0	0	0	1.35	0
Backlick Run	000411ND	X	5860	FARRINGTON AV		<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1	No Access	0	0	0	1.35	0
Backlick Run	000421ND	X		TANCRETI		<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000422ND	X	520	CAMERON STATION BV		<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1	No Access	0	0	0	0	0
Backlick Run	000449ND	X	5601	EISENHOWER AV		<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1	Not found	0	0	0	2.43	0
Backlick Run	000450ND	X	5261	EISENHOWER AV	Parking Lot	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000451ND	X	5261	EISENHOWER AV	Parking Lot	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000505ND	X	230	MURTHA ST		<a href="#">02/21/2013</a>	<a href="#">02/21/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000519ND	X	5255	COLONEL JOHNSON LA		<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000555ND	X	6025	TOWER CT		<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1	Not found	0	0	0	2.43	0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	000605IO	X	99	S BRAGG ST	Easement	<a href="#">02/14/2013</a>	<a href="#">02/14/2013</a>	Truck 1	1		10	10	0	2.43	1
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	000608IO	X	6000	EDSALL	Easement	<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000609IO	X				<a href="#">07/16/2013</a>	<a href="#">07/16/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	000668ND	X	240	YOAKUM PY		<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1	No Access	0	0	0	1.35	0
Backlick Run	000675ND	X	211	YOAKUM PY		<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000676ND	X	240	YOAKUM PY		<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000677ND	X	6000	EDSALL RD		<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1	No Access	0	0	0	2.43	0
Backlick Run	000678ND	X	240	YOAKUM PY		<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1	No Access	0	0	0	1.35	0
Backlick Run	000722SMH	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		0	0	0	1.35	2
Backlick Run	000723SMH	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		14	14	0	1.35	3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
Backlick Run	000724SMH	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		29	29	0	1.35	2
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	000725SMH	X	230	MURTHA ST	Light Highway Rural Streets	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		29	29	0	2.43	2
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Backlick Run	000726SMH	X	4800	BRENMAN PARK DR	Light Highway Rural Streets	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	000727SMH	X	4800	BRENMAN PARK DR	Light Highway Rural Streets	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		29	29	0	2.43	3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	000730SMH	X	4800	BRENMAN PARK DR	Light Highway Rural Streets	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		48	49	0	2.43	2
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	000731SMH	X	4951	BRENMAN PARK DR	Light Highway Rural Streets	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
						Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural						
						Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
Backlick Run	000731SMH	X	4951	BRENMAN PARK DR	Light Highway Rural Streets	11/02/2012	11/02/2012	Truck 1	1		59	60	0	1.5	4
Backlick Run	000732SMH	X	4951	BRENMAN PARK DR	Light Highway Rural Streets	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
						Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural						
						Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chimney/Shelf	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I						
						Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural						
						Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I						
						Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural						
Backlick Run	000732SMH	X	4951	BRENMAN PARK DR	Light Highway Rural Streets	11/02/2012	11/02/2012	Truck 1	1		48	49	0	1.5	4
Backlick Run	000745SMH	X	4800	BRENMAN PARK DR	Easement	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
						Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural						
						Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural						
						Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
						Chimney/Shelf	Mortar missing	Min: <10% of area	Structural						
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural						
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
Backlick Run	000745SMH	X	4800	BRENMAN PARK DR	Easement	11/02/2012	11/02/2012	Truck 1	1		79	79	0	2.43	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked									
Backlick Run	000746SMH	X	4800	BRENMAN PARK DR	Light Highway Rural Streets	11/02/2012	11/02/2012	Truck 1	1		56	57	0	1.35	4
					Frame Base Seal	I/I evidence				I/I					
					Frame Base Seal	Corroded, pitted, spalled				Structural					
					Frame Base Seal	Cracked / deteriorated				Structural					
					Chimney/Shft	Cracked				Structural					
					Chimney/Shft	Corroded, pitted, spalled				Structural					
					Chimney/Shft	I/I evidence				I/I					
					Chamber	Corroded, pitted, spalled				Structural					
					Chamber	Cracked				Structural					
					Chamber	I/I evidence				I/I					
Backlick Run	001013SMH	X	5860	FARRINGTON AV	Sidewalk	03/14/2013	03/14/2013	Truck 1	1		60	58	5	1.35	3
Backlick Run	001014SMH	X	5859	FARRINGTON AV	Chamber	Cracked				Structural					
					Chamber	I/I evidence				I/I					
					Chamber	Corroded, pitted, spalled				Structural					
					Channel	Debris/deposition				Maintenance					
Backlick Run	001014SMH	X	5859	FARRINGTON AV	Light Highway Rural Streets	03/14/2013	03/14/2013	Truck 1	1		18	19	0	0	4
Backlick Run	001017SMH	X	5860	FARRINGTON AV	Frame Base Seal	I/I evidence				I/I					
					Frame Base Seal	Corroded, pitted, spalled				Structural					
					Frame Base Seal	I/I evidence				I/I					
					Chimney/Shft	Cracked				Structural					
					Chimney/Shft	Corroded, pitted, spalled				Structural					
Backlick Run	001018SMH	X	5860	FARRINGTON AV	Light Highway Rural Streets	03/15/2013	03/15/2013	Truck 1	1		56	57	0	1.35	3
Backlick Run	001018SMH	X	5860	FARRINGTON AV	Frame Base Seal	Corroded, pitted, spalled				Structural					
					Frame Base Seal	Cracked / deteriorated				Structural					
					Frame Base Seal	I/I evidence				I/I					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Chimney/Shaft Chimney/Shaft Chimney/Shaft Chamber Chamber Chamber	Cracked I/I evidence Corroded, pitted, spalled I/I evidence Corroded, pitted, spalled Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural I/I Structural I/I Structural Structural												
Backlick Run	001019SMH	X	1		Light Highway Rural Streets	03/14/2013	03/14/2013	Truck 1	1		0	0	0	1.5	4
Backlick Run	001020SMH	X	5700	EISENHOWER AV	Easement	03/07/2013	03/07/2013	Truck 1	1		18	19	0	2.43	3
Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shaft Chimney/Shaft Chamber Chamber Chamber	Corroded, pitted, spalled I/I evidence Min: <10% mat'l loss, <3/8" (1cm) etching Corroded, pitted, spalled I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping Cracked / deteriorated Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <10% mat'l loss, etching	Structural I/I Structural Structural I/I Structural Structural Structural												
Backlick Run	001021SMH	X	5700	EISENHOWER AV	Sidewalk	03/07/2013	03/07/2013	Truck 1	1		54	55	0	2.43	2
Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shaft Chimney/Shaft Chamber Chamber Chamber Chamber	Cracked / deteriorated Corroded, pitted, spalled I/I evidence Corroded, pitted, spalled Cracked Corroded, pitted, spalled Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, <3/8" (1cm) etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural Structural I/I Structural Structural Structural Structural I/I												
Backlick Run	001022SMH	X	5859	FARRINGTON AV	Light Highway Rural Streets	03/14/2013	03/14/2013	Truck 1	1		56	57	0	2.43	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001023SMH	X	511	S VAN DORN ST	Light Highway Rural Streets	03/15/2013	03/15/2013	Truck 1	1		56	57	0	1.35	4
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001024SMH	X	520	CAMERON STATION BV	Easement	01/28/2013	01/28/2013	Truck 1	1		64	14	59	2.43	2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
					Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
Backlick Run	001025SMH	X	530	CAMERON STATION BV	Easement	01/28/2013	01/28/2013	Truck 1	1		59	61	0	0	3
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001026SMH	X	530	CAMERON STATION BV	Easement	01/28/2013	01/28/2013	Truck 1	1		14	14	0	2.43	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
Backlick Run	001030SMH	X	557	S VAN DORN ST	Light Highway Rural Streets	03/15/2013	03/15/2013	Truck 1	1		56	57	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001031SMH	X	700	S PICKETT ST	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural		56	57	0	0	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001033SMH	X	520	S VAN DORN ST	Light Highway Rural Streets	03/14/2013	03/14/2013	Truck 1	1		69	70	0	1.35	5
Backlick Run	001033SMH	X	520	S VAN DORN ST	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001034SMH	X	700	S PICKETT ST	Light Highway Rural Streets	<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1		59	60	0	1.35	4
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001035SMH	X	1		Easement	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		0	0	0	1.35	4
Backlick Run	001036SMH	X	1		Yard-Back	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	001037SMH	X	1		Yard-Back	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	001038SMH	X	1		Yard-Back	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	001098SMH	X	820	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		56	57	0	1.35	3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001099SMH	X	841	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		54	55	0	2.43	2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001100SMH	X	840	S PICKETT ST	Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	001101SMH	X	840	S PICKETT ST	Yard-Front	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		47	48	0	2.43	3
Backlick Run	001101SMH	X	840	S PICKETT ST	Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
Backlick Run	001102SMH	X	841	S PICKETT ST	Light Highway Rural Streets	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		37	38	0	2.43	3
Backlick Run	001102SMH	X	841	S PICKETT ST	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shelf	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	001103SMH	X	950	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		57	58	0	2.43	3
Backlick Run	001103SMH	X	950	S PICKETT ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing			Structural					
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural					
Backlick Run	001109SMH	X	726	S PICKETT ST	Sidewalk	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		61	61	0	2.43	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001111SMH	X	557	S VAN DORN ST	Light Highway Rural Streets	<a href="#">03/15/2013</a>	<a href="#">03/15/2013</a>	Truck 1	1		56	57	0	0	4
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001112SMH	X	555	S VAN DORN ST	Driveway	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		62	62	0	2.43	3
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001113SMH	X	555	S VAN DORN ST	Easement	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		15	15	0	2.43	2
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
Backlick Run	001114SMH	X	555	S VAN DORN ST	Easement	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		0	0	0	1.35	4
Backlick Run	001119SMH	X	520	CAMERON STATION BV	Easement	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		37	38	0	2.43	3
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001121SMH	X	519	CAMERON STATION BV	Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Channel	Debris/deposition	Mod: 1-3gal bucket			Maintenance					
Backlick Run	001122SMH	X	530	CAMERON STATION BV	Sidewalk	01/24/2013	01/24/2013	Truck 1	1		0	0	0	2.43	2
Backlick Run	001123SMH	X	400	CAMERON STATION BV	Light Highway Rural Streets	02/11/2013	02/11/2013	Truck 1	1		45	46	0	2.43	4
Backlick Run	001124SMH	X	400	CAMERON STATION BV	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	001126SMH	X	435	FERDINAND DAY DR	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled		Min: <10% mat'l loss, etching		Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001128SMH	X	435	FERDINAND DAY DR	Light Highway Rural Streets	<a href="#">02/11/2013</a>	<a href="#">02/11/2013</a>	Truck 1	1		45	46	0	1.5	4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled		Min: <10% mat'l loss, <3/8" (1cm) etching		Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled		Min: <10% mat'l loss, etching		Structural					
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching		Structural					
Backlick Run	001131SMH	X	444	FERDINAND DAY DR	Light Highway Rural Streets	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		51	52	0	2.43	3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled		Min: <10% mat'l loss, <3/8" (1cm) etching		Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled		Min: <10% mat'l loss, etching		Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001132SMH	X	424	FERDINAND DAY DR	Light Highway Rural Streets	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		51	52	0	2.43	2
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled		Min: <10% mat'l loss, <3/8" (1cm) etching		Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled		Min: <10% mat'l loss, etching		Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001133SMH	X	416	FERDINAND DAY DR	Light Highway Rural Streets	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		41	42	0	2.43	2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled		Min: <10% mat'l loss, <3/8" (1cm) etching		Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001134SMH	X	450	FERDINAND DAY DR	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I		41	42	0	1.35	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001135SMH	X	400	CAMERON STATION BV	Light Highway Rural Streets	02/11/2013	02/11/2013	Truck 1	1		48	49	0	2.43	4
Backlick Run	001136SMH	X	400	CAMERON STATION BV	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural		59	60	0	2.43	4
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001137SMH	X	400	CAMERON STATION BV	Light Highway Rural Streets	02/11/2013	02/11/2013	Truck 1	1		94	94	0	2.43	2
Backlick Run	001137SMH	X	400	CAMERON STATION BV	Cover	Cracked / deteriorated	Maj: >1/8" (3mm) width		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling														
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching														
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
Backlick Run	001138SMH	X	391	CAMERON STATION BV	Light Highway Rural Streets	02/11/2013	02/11/2013	Truck 1	1		48	49	0	2.43	2						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching														
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling														
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling														
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching														
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
Backlick Run	001139SMH	X	320	CAMERON STATION BV	Light Highway Rural Streets	01/17/2013	01/17/2013	Truck 1	1		64	52	35	2.43	2						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling														
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching														
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching														
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching														
					Channel	Debris/deposition	Maj: 3-5gal bucket														
Backlick Run	001140SMH	X	366	CAMERON STATION BV	Light Highway Rural Streets	01/17/2013	01/17/2013	Truck 1	1		57	57	5	2.43	3						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling														
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching														
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling														
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching														
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling														
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching														

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						
Backlick Run	001141SMH	X	519	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">03/15/2013</a>	<a href="#">03/15/2013</a>	Truck 1	1		18	19	0	2.43	3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001142SMH	X	519	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1		56	57	0	1.35	2
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001143SMH	X	350	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1		48	14	35	2.43	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Channel	Debris/deposition	Maj: 3-5gal bucket		Maintenance						
Backlick Run	001144SMH	X	5001	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		54	55	0	2.43	3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001145SMH	X	5001	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		59	60	0	2.43	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Chimney/Shaft Corroded, pitted, spalled I/I evidence Chamber I/I evidence Chamber Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod:10-25% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Structural Structural I/I I/I Structural Structural													
Backlick Run	001146SMH	X	4900	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	001147SMH	X	4840	EISENHOWER AV	Yard-Front	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		29	29	0	2.43	3
Frame Base Seal Corroded, pitted, spalled I/I evidence Chimney/Shaft Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, <3/8" (1cm) etching Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural Structural I/I Structural Structural													
Backlick Run	001148SMH	X	4840	EISENHOWER AV	Light Highway Rural Streets	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		41	41	0	1.35	2
Frame Base Seal Corroded, pitted, spalled I/I evidence Chimney/Shaft Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural I/I Structural Structural													
Backlick Run	001157SMH	X	5200	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		54	55	0	2.43	2
Frame Base Seal Corroded, pitted, spalled I/I evidence Chimney/Shaft Corroded, pitted, spalled Chamber Corroded, pitted, spalled Cracked	Min: <10% mat'l loss, <3/8" (1cm) etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural Structural I/I Structural Structural I/I													
Backlick Run	001159SMH	X	5200	EISENHOWER AV	Sidewalk	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		44	45	0	0	3
Chamber Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces	I/I													

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001160SMH	X	5300	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		63	64	0	2.43	3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001161SMH	X	5261	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		62	62	0	2.43	3
					Frame	Offset	Mod: 2" to 3" (5-7.5cm)		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001165SMH	X	5261	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		59	60	0	2.43	2
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001166SMH	X	5263	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		48	49	0	2.43	5

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001167SMH	X	5301	EISENHOWER AV	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001167SMH	X	5301	EISENHOWER AV	Parking Lot	01/28/2013	01/28/2013	Truck 1	1		48	49	0	0	3
Backlick Run	001168SMH	X	5301	EISENHOWER AV	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001168SMH	X	5301	EISENHOWER AV	Parking Lot	01/28/2013	01/28/2013	Truck 1	1		56	57	0	2.43	2
Backlick Run	001170SMH	X	5300	EISENHOWER AV	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001170SMH	X	5300	EISENHOWER AV	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001285SMH	X	151	CAMERON STATION BV	Light Highway Rural Streets	02/06/2013	02/06/2013	Truck 1	1		41	41	0	1.5	3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001286SMH	X	106	MARTIN LA	Brick	<a href="#">02/06/2013</a>	<a href="#">02/06/2013</a>	Truck 1	1		48	49	0	2.43	2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001288SMH	X	4950	BRENNAN PARK DR	Light Highway Rural Streets	<a href="#">02/06/2013</a>	<a href="#">02/06/2013</a>	Truck 1	1		45	46	0	1.5	2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001290SMH	X	106	MARTIN LA	Light Highway Rural Streets	<a href="#">02/21/2013</a>	<a href="#">02/21/2013</a>	Truck 1	1		44	45	0	2.43	3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001291SMH	X	106	MARTIN LA	Light Highway Rural Streets	<a href="#">02/21/2013</a>	<a href="#">02/21/2013</a>	Truck 1	1		51	52	0	2.43	4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001292SMH	X	106	MARTIN LA	Light Highway Rural Streets	<a href="#">02/21/2013</a>	<a href="#">02/21/2013</a>	Truck 1	1		51	52	0	2.43	2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001293SMH	X	230	MURTHA ST	Light Highway Rural Streets	<a href="#">02/21/2013</a>	<a href="#">02/21/2013</a>	Truck 1	1		48	49	0	2.43	3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001294SMH	X	106	MARTIN LA	Light Highway Rural Streets	<a href="#">02/21/2013</a>	<a href="#">02/21/2013</a>	Truck 1	1		51	52	0	2.43	3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001295SMH	X	335	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	<a href="#">01/15/2013</a>	Truck 1	1		56	57	0	2.43	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001296SMH	X	5255	COLONEL JOHNSON LA	Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	001296SMH	X	5255	COLONEL JOHNSON LA	Light Highway Rural Streets	01/15/2013	01/15/2013	Truck 1	1		56	57	0	2.43	3
Backlick Run	001297SMH	X	5255	COLONEL JOHNSON LA	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Backlick Run	001297SMH	X	5255	COLONEL JOHNSON LA	Light Highway Rural Streets	01/15/2013	01/15/2013	Truck 1	1		59	61	0	2.43	2
Backlick Run	001298SMH	X	349	CAMERON STATION BV	Frame Base Seal	I/I evidence	Mod: 1-3gpm, trickle, flow dripping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	I/I evidence	Mod: 1-3gpm, trickle, flow dripping			I/I					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	001298SMH	X	349	CAMERON STATION BV	Sidewalk	01/17/2013	01/17/2013	Truck 1	1		50	50	0	2.43	3
Backlick Run	001299SMH	X	349	CAMERON STATION BV	Frame	Offset	Maj: 3" to 4" (7.5-10cm)			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001300SMH	X	336	CAMERON STATION BV	Light Highway Rural Streets	01/15/2013	01/15/2013	Truck 1	I/I		56	57	0	2.43	3
Backlick Run	001301SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	01/15/2013	01/15/2013	Truck 1	I/I		29	29	0	2.43	3
Backlick Run	001302SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	01/15/2013	01/15/2013	Truck 1	I/I		36	36	0	2.43	2
Backlick Run	001303SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	01/15/2013	01/15/2013	Truck 1	I/I		56	57	0	2.43	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Backlick Run	001304SMH	X	320	CAMERON STATION BV	Yard-Front	<a href="#">01/15/2013</a>	<a href="#">01/15/2013</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	001305SMH	X	200	S PICKETT ST	Driveway	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		65	66	0	2.43	3
					Frame	Offset	Mod: 2" to 3" (5-7.5cm)			Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Bench	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural					
					Channel	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural					
Backlick Run	001306SMH	X	200	S PICKETT ST	Light Highway Rural Streets	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		64	65	0	2.43	2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
Backlick Run	001307SMH	X	300	S PICKETT ST	Light Highway Rural Streets	<a href="#">03/05/2013</a>	<a href="#">03/05/2013</a>	Truck 1	1		56	57	0	2.43	3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001308SMH	X	401	S PICKETT ST	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural	I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping	42	43	0	2.43	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001310SMH	X	106	MARTIN LA	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural	I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping	56	57	0	1.5	4
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001311SMH	X	4951	BRENMAN PARK DR	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural	I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping	48	49	0	2.43	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
Backlick Run	001313SMH	X	300	S PICKETT ST	Parking Lot	03/05/2013	03/05/2013	Truck 1	1		28	29	0	2.43	2	
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
Backlick Run	001314SMH	X	300	S PICKETT ST	Parking Lot	03/05/2013	03/05/2013	Truck 1	1		47	48	0	2.43	2	
				S PICKETT ST	Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
Backlick Run	001315SMH	X	450	S PICKETT ST	Parking Lot	03/05/2013	03/05/2013	Truck 1	1		30	30	0	2.43	4	
				S REYNOLDS ST	Frame	Offset	Mod: 2" to 3" (5-7.5cm)		Structural							
Backlick Run	001316SMH	X	270		Sidewalk	03/05/2013	03/05/2013	Truck 1	1		57	58	0	2.43	2	
					Chimney/Shelf	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
					Chimney/Shelf	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Backlick Run	001317SMH	X	270	S REYNOLDS ST	Sidewalk	01/24/2013	01/24/2013	Truck 1	1		36	36	0	2.43	2	
				S REYNOLDS ST	Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Backlick Run	001318SMH	X	240	S REYNOLDS ST	Yard-Side	01/24/2013	01/24/2013	Truck 1	1		56	57	0	0	3	
				S REYNOLDS ST	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes							
Backlick Run	001319SMH	X	240	S REYNOLDS ST	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural			56	57	0	2.43	3							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling															
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching															
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching															
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling															
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping															
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling															
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching															
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching															
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling															
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping															
Backlick Run	001320SMH	X	240	S REYNOLDS ST	Easement	01/24/2013	01/24/2013	Truck 1	1		47	48	0	2.43	2							
Backlick Run	001329SMH	X	6300	STEVENSON AV	Offset	Min: 7/8" to 2" (2.5-5cm)	Structural				0	0	0	2.43	2							
Backlick Run	001333SMH	X	99	S BRAGG ST	Easement	02/13/2013	02/13/2013	Truck 1	1		78	78	0	1.5	2							
Backlick Run	001335SMH	X	99	S BRAGG ST	Offset	Extreme: > 4" (10cm)	Structural				0	0	0	2.43	2							
Backlick Run	001335SMH	X	99	S BRAGG ST	Parking Lot	02/13/2013	02/13/2013	Truck 1	1		37	38	0	2.43	2							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001337SMH	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1		56	57	0	2.43	4
Backlick Run	001338SMH	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1		15	15	0	2.43	2
				Frame	Offset	Min: 7/8" to 2" (2.5-5cm)			Structural						
Backlick Run	001349SMH	X	200	S WHITING ST	Yard-Side	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		51	52	0	1.35	2
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Backlick Run	001350SMH	X	200	S WHITING ST	Yard-Side	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	001351SMH	X	200	S WHITING ST	Yard-Side	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		0	0	0	1.35	2
Backlick Run	001361SMH	X	6301	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		56	57	0	1.35	4
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001363SMH	X	6301	STEVENSON AV	Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
Backlick Run	001363SMH	X	6301	STEVENSON AV	Driveway	03/06/2013	03/06/2013	Truck 1	1		56	57	0	1.35	4
Backlick Run	001364SMH	X	6300	STEVENSON AV	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
Backlick Run	001364SMH	X	6300	STEVENSON AV	Main Highway Suburban	03/06/2013	03/06/2013	Truck 1	1		37	38	0	1.35	4
Backlick Run	001367SMH	X	200	YOAKUM PY	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	001367SMH	X	200	YOAKUM PY	Light Highway Rural Streets	03/06/2013	03/06/2013	Truck 1	1		56	57	0	1.35	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001368SMH	X	6300	STEVENSON AV	Light Highway Rural Streets	03/06/2013	03/06/2013	Truck 1	1		56	57	0	1.35	4
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001369SMH	X	6300	STEVENSON AV	Light Highway Rural Streets	03/06/2013	03/06/2013	Truck 1	1		56	57	0	2.43	3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001372SMH	X	6301	STEVENSON AV	Sidewalk	03/06/2013	03/06/2013	Truck 1	1		50	51	0	2.43	2
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001374SMH	X	6301	STEVENSON AV	Easement	03/06/2013	03/06/2013	Truck 1	1		56	57	0	2.43	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001375SMH	X	6301	STEVENSON AV	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
											53	54	0	1.35	2
Backlick Run	001393SMH	X	27	S BRAGG ST	Sidewalk	02/06/2013	02/06/2013	Truck 1	1		50	51	0	1.35	3
Backlick Run	001394SMH	X	27	S BRAGG ST	Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
											50	51	0	1.35	3
Backlick Run	001394SMH	X	27	S BRAGG ST	Light Highway Rural Streets	02/06/2013	02/06/2013	Truck 1	1		50	51	0	1.35	2
Backlick Run	001394SMH	X	27		Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001395SMH	X	27	S BRAGG ST	Light Highway Rural Streets	02/06/2013	02/06/2013	Truck 1	1		50	51	0	2.43	3
				Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Backlick Run	001425SMH	X	27	S BRAGG ST	Sidewalk	02/06/2013	02/06/2013	Truck 1	1		15	15	0	2.43	2
				Frame	Offset	Min: 7/8" to 2" (2.5-5cm)			Structural						
Backlick Run	001426SMH	X	27	S BRAGG ST	Sidewalk	02/06/2013	02/06/2013	Truck 1	1		50	51	0	2.43	2
				Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Backlick Run	001427SMH	X	27	S BRAGG ST	Sidewalk	02/06/2013	02/06/2013	Truck 1	1		50	51	0	2.43	2
				Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	001429SMH	X	6300	STEVENSON AV	Light Highway Rural Streets	03/06/2013	03/06/2013	Truck 1	1		52	51	5	1.35	3
				Frame	Offset	Min: 7/8" to 2" (2.5-5cm)			Structural						
				Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001430SMH	X	266	N STEVENSON SQ	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Channel	Debris/deposition	Min: <1gal bucket			Maintenance					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	001431SMH	X	505	S VAN DORN ST	Light Highway Rural Streets	03/14/2013	03/14/2013	Truck 1	1	I/I					
Backlick Run	001432SMH	X	400	S WHITING ST	Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	001437SMH	X	400	S WHITING ST	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	001438SMH	X	400	S WHITING ST	Light Highway Rural Streets	<a href="#">03/15/2013</a>	<a href="#">03/15/2013</a>	Truck 1	1		56	57	0	1.35	3
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Backlick Run	001439SMH	X	400	S WHITING ST	Light Highway Rural Streets	<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1		45	46	0	2.43	4
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Backlick Run	001440SMH	X	400	S WHITING ST	Light Highway Rural Streets	<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1		61	62	0	2.43	4
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001441SMH	X	5901	EDSALL RD	Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural		56	57	0	2.43	3
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001442SMH	X	400	S WHITING ST	Light Highway Rural Streets	<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1		55	56	0	1.35	2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001447SMH	X	6161	EDSALL RD		<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1	Not found	0	0	0	2.43	0
Backlick Run	001448SMH	X	6161	EDSALL RD		<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1	Not found	0	0	0	2.43	0
Backlick Run	001449SMH	X	6000	EDSALL RD	Light Highway Rural Streets	<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1		56	57	0	1.35	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001450SMH	X	6000	EDSALL RD	Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	001452SMH	X	6000	EDSALL RD	Light Highway Rural Streets	03/14/2013	03/14/2013	Truck 1	1		45	46	0	2.43	2
Backlick Run	001746SMH	X	245	CAMERON STATION BV	Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural					
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	I/I evidence	Mod: 1-3gpm, trickle, flow dripping			I/I					
					Chimney/Shelf	Mortar missing	Min: <10% of area			Structural					
					Chimney/Shelf	Bricks displaced or missing	Min: <5% of area			Structural					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	001746SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	01/15/2013	01/15/2013	Truck 1	1		56	57	0	2.43	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	001748SMH	X	320	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	<a href="#">01/15/2013</a>	Truck 1	1		56	57	0	2.43	3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	001750SMH	X	300	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">02/11/2013</a>	<a href="#">02/11/2013</a>	Truck 1	1		54	55	0	1.35	3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	001751SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/15/2013</a>	<a href="#">01/15/2013</a>	Truck 1	1		56	57	0	2.43	2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001752SMH	X	245	CAMERON STATION BV	Light Highway Rural Streets	Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
Backlick Run	001754SMH	X	5660	EDSALL RD	Sidewalk	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
Backlick Run	001755SMH	X	423	S REYNOLDS ST	Light Highway Rural Streets	Frame	Offset	Mod: 2" to 3" (5-7.5cm)	Structural						
Backlick Run	001756SMH	X	611	S PICKETT ST	Parking Lot	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001757SMH	X	333	S REYNOLDS ST	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I			54	55	0	2.43	3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Backlick Run	001758SMH	X	333	S REYNOLDS ST	Light Highway Rural Streets	03/05/2013	03/05/2013	Truck 1	1		56	57	0	2.16	3
Backlick Run	001758SMH	X	333	S REYNOLDS ST	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural			56	57	0	2.16	3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Backlick Run	001759SMH	X	423	S REYNOLDS ST	Yard-Front	03/05/2013	03/05/2013	Truck 1	1		28	29	0	2.43	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
Backlick Run	001760SMH	X	423	S REYNOLDS ST	Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				S VAN DORN ST	Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Backlick Run	001761SMH	X	201	S VAN DORN ST	Parking Lot	03/07/2013	03/07/2013	Truck 1	1	I/I	37	38	0	2.43	2	
Backlick Run	001763SMH	X	240		Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Backlick Run	001764SMH	X	211	YOAKUM PY	Easement	03/11/2013	03/11/2013	Truck 1	1	I/I	49	49	0	2.43	4	
Backlick Run	001765SMH	X	611		Frame	Offset	Mod: 2" to 3" (5-7.5cm)			Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
					Frame Base Seal	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching			Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Backlick Run	001765SMH	X	611	S PICKETT ST	Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	001765SMH	X	611		Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Light Highway	03/05/2013	03/05/2013	Truck 1	1	I/I	46	46	0	2.43	2	
					Rural Streets	Frame Base Seal	Corroded, pitted, spalled			Structural						
Backlick Run	001765SMH	X	611		Frame Base Seal	I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching			I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes		
Backlick Run	001767SMH	X	211	YOAKUM PY	Driveway	03/11/2013	03/11/2013	Truck 1	1		49	50	0	2.43	3		
Backlick Run	001768SMH	X	211	YOAKUM PY	Light Highway Rural Streets	03/13/2013	03/13/2013	Truck 1	1		56	57	0	2.43	3		
Backlick Run	001770SMH	X	300	YOAKUM PY	Easement	03/11/2013	03/11/2013	Truck 1	1		38	39	0	2.43	5		
Backlick Run	001771SMH	X	6135	EDSALL RD	Sidewalk	03/13/2013	03/13/2013	Truck 1	1		0	0	0	2.43	3		
Backlick Run	001772SMH	X	6161	EDSALL RD	Light Highway Rural Streets	03/13/2013	03/13/2013	Truck 1	1		69	70	0	2.43	3		
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I								
					Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural							
					Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Chimney/Shaft Chimney/Shaft Chimney/Shaft Chamber Chamber Chamber Bench Bench Channel Channel	Corroded, pitted, spalled I/I evidence Cracked I/I evidence Cracked Corroded, pitted, spalled Corroded, pitted, spalled Cracked Cracked Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod:10-25% mat'l loss, etching Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Structural I/I Structural I/I Structural Structural Structural Structural Structural Structural												
Backlick Run	001773SMH	X	6200	EDSALL RD	Yard-Front	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1		38	39	0	1.35	3
Chimney/Shaft Chimney/Shaft Chamber	Corroded, pitted, spalled Cracked Cracked	Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural Structural Structural												
Backlick Run	001774SMH	X	6200	EDSALL RD	Yard-Front	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1		0	0	0	1.35	3
Backlick Run	001778SMH	X	211	YOAKUM PY	Driveway	<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1		59	61	0	2.43	3
Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shaft Chimney/Shaft Chimney/Shaft Chamber Chamber	I/I evidence Cracked / deteriorated Corroded, pitted, spalled I/I evidence Corroded, pitted, spalled Cracked Cracked Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16"-3/8" (2-10mm) width, small pieces Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	I/I Structural Structural I/I Structural Structural Structural Structural												
Backlick Run	001779SMH	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1		50	50	0	2.43	3
Chamber Chamber Chamber	Corroded, pitted, spalled I/I evidence Cracked	Mod:10-25% mat'l loss, etching Mod: 1-3gpm, trickle, flow dripping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural I/I Structural												

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	001780SMH	X	211	YOAKUM PY		<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1	Not found	0	0	0	2.43	0
Backlick Run	001781SMH	X	211	YOAKUM PY		<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1	Not found	0	0	0	1.5	0
Backlick Run	001782SMH	X	211	YOAKUM PY		<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1	Not found	0	0	0	1.35	0
Backlick Run	001783SMH	X	6000	EDSALL RD	Parking Lot	<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1		59	60	0	1.35	5
						Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural						
						Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
						Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural						
						Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
						Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural						
Backlick Run	002137IN	X	5131	BRAWNER PL	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		0	0	0	2.43	2
Backlick Run	002140IN	X	4800	BRENNAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		37	38	0	2.43	3
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
						Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural						
Backlick Run	002143IN	X	230	MURTHA ST	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		37	38	0	2.43	2
Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural												
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I												
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural												
Backlick Run	002153IN	X	4800	BRENNAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		42	42	0	2.43	3
						Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
						Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I						
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural						
Backlick Run	002155IN	X	4901	DUKE ST	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		52	52	0	1.5	3
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
						Pipe Connection-2	Pipe cracked	Extreme: >1/4" (6mm) width, pieces, missing	Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	002159IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		22	22	0	1.5	3
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	002160IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		37	38	0	2.43	3
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	002162IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		56	38	35	2.43	3
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Channel	Debris/deposition	Maj: 3-5gal bucket			Maintenance						
Backlick Run	002164IN	X	4901	DUKE ST	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		37	38	0	2.43	3
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	002169IN	X	4901	DUKE ST	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		14	14	0	2.43	3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
Backlick Run	002175IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	002177IN	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		37	38	0	2.43	2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	002185IN	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		37	38	0	2.43	4
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Backlick Run	002189IN	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		0	0	0	2.43	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	002190IN	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		37	38	0	2.43	2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	002252ND	X		CAMERON STATION		<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1	No Access	0	0	0	1.35	0
Backlick Run	002256ND	X		REYNOLDS		<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1	Not found	0	0	0	1.35	0
Backlick Run	003041IN	X	821	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		44	45	0	2.43	2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003043IN	X	800	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		37	38	0	2.43	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	003045IN	X	841	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		0	0	0	1.35	0
Backlick Run	003047IN	X	841	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		44	45	0	1.5	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Backlick Run	003048IN	X	840	S PICKETT ST	Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		99	99	0	2.43	3
					Cover	Cracked / deteriorated	Extreme: separating into pieces		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
Backlick Run	003051IN	X	840	S PICKETT ST	Sidewalk	02/05/2013	02/05/2013	Truck 1	1		59	59	0	2.43	2
					Frame Base Seal	Corroded, pitted, spalled		Min: <10% mat'l loss, <3/8" (1cm) etching	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Cracked		Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
Backlick Run	003053IN	X	880	S PICKETT ST	Sidewalk	02/05/2013	02/05/2013	Truck 1	1		57	58	0	0	4
Backlick Run	003054IN	X	841	S PICKETT ST	Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Corroded, pitted, spalled		Mod: 10-25% mat'l loss, etching	Structural						
					Chamber	Cracked		Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
Backlick Run	003057IN	X	950	S PICKETT ST	Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	Cracked		Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Channel	Debris/deposition		Mod: 1-3gal bucket	Maintenance						
					Chamber	Corroded, pitted, spalled									
Backlick Run	003058IN	X	841	S PICKETT ST	Sidewalk	02/05/2013	02/05/2013	Truck 1	1		57	58	0	1.35	2
					Chamber	Corroded, pitted, spalled		Mod: 10-25% mat'l loss, etching	Structural						
					Chamber	Cracked		Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Cracked		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
Backlick Run	003063IN	X	841	S PICKETT ST	Parking Lot	02/05/2013	02/05/2013	Truck 1	1		44	45	0	1.35	3
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Cracked		Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	Cracked		Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing	Structural						
Backlick Run	003064IN	X	950	S PICKETT ST	Sidewalk	02/05/2013	02/05/2013	Truck 1	1		44	45	0	2.43	2
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	003065IN	X	619	BURNSIDE PL	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural					
					Cover	Missing or Displaced	Missing but replaced			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					BURNSIDE PL	Sidewalk	02/05/2013	02/05/2013	Truck 1	1	37	38	0	2.43	3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural					
Backlick Run	003069IN	X	620	S PICKETT ST	Parking Lot	02/05/2013	02/05/2013	Truck 1	1	48	49	0	1.35	2	
Backlick Run	003070IN	X	841	S PICKETT ST	Cover	Cracked / deteriorated	Extreme: separating into pieces			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
Backlick Run	003075IN	X	628	S PICKETT ST	Sidewalk	01/28/2013	01/28/2013	Truck 1	1	44	45	0	2.43	2	
Backlick Run	003077IN	X	557	S VAN DORN ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Backlick Run	003077IN	X	557	S VAN DORN ST	Sidewalk	03/07/2013	03/07/2013	Truck 1	1	60	58	5	2.43	4	
Backlick Run	003077IN	X	557	S VAN DORN ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						
Backlick Run	003082IN	X	700	S PICKETT ST	Sidewalk	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		44	45	0	2.43	4
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003085IN	X	555	S VAN DORN ST	Sidewalk	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		51	52	0	2.43	2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003094IN	X	511	S VAN DORN ST	Sidewalk	<a href="#">03/15/2013</a>	<a href="#">03/15/2013</a>	Truck 1	1		37	38	0	2.43	2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003095IN	X	511	S VAN DORN ST	Sidewalk	<a href="#">03/15/2013</a>	<a href="#">03/15/2013</a>	Truck 1	1		37	38	0	1.35	4
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003100IN	X	611	S PICKETT ST	Sidewalk	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		50	50	0	2.43	2
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003101IN	X	611	S PICKETT ST	Parking Lot	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		44	45	0	2.43	2
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	003105IN	X	550	S PICKETT ST	Sidewalk	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		48	45	2	2.43	2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Bench	Debris/deposition	Min: <1gal bucket		Maintenance						
Backlick Run	003117IN	X	701	S VAN DORN ST	Curb/Gutter	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		57	58	0	2.43	3
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003118IN	X	701	S VAN DORN ST	Light Highway Rural Streets	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		45	38	10	2.43	3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Bench	Debris/deposition	Min: <1gal bucket		Maintenance						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						
Backlick Run	003120IN	X	5860	FARRINGTON AV	Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		42	26	25	2.43	2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Bench	Debris/deposition	Mod: 1-3gal bucket		Maintenance						
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance						
Backlick Run	003121IN	X	1		Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		0	0	0	2.43	2
Backlick Run	003122IN	X	1		Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		0	0	0	2.43	2
Backlick Run	003123IN	X	1		Sidewalk	<a href="#">02/05/2013</a>	<a href="#">02/05/2013</a>	Truck 1	1		10	10	0	2.43	3
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Backlick Run	003132IN	X	623	S PICKETT ST	Sidewalk	<a href="#">01/28/2013</a>	<a href="#">01/28/2013</a>	Truck 1	1		44	45	0	2.43	2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003379IN	X	5902	FARRINGTON AV	Paved Asphalt	<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1		50	50	0	2.43	3



Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Chimney/Shaft Chimney/Shaft Chamber Chamber Chamber	Corroded, pitted, spalled I/I evidence Cracked Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural I/I Structural Structural I/I												
Backlick Run	003432IN	X	433	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	003436IN	X	519	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	003439IN	X	519	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		37	38	0	2.43	2
Chamber Chamber Chamber	Cracked Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural Structural I/I												
Backlick Run	003441IN	X	433	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		26	26	0	2.43	2
Chamber Chamber	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural I/I												
Backlick Run	003442IN	X	519	CAMERON STATION BV	Sidewalk	<a href="#">02/11/2013</a>	<a href="#">02/11/2013</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	003443IN	X	433	CAMERON STATION BV	Sidewalk	<a href="#">02/11/2013</a>	<a href="#">02/11/2013</a>	Truck 1	1		37	38	0	2.43	2
Chamber Chamber Chamber	I/I evidence Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I Structural Structural												
Backlick Run	003452IN	X	435	FERDINAND DAY DR	Sidewalk	<a href="#">02/11/2013</a>	<a href="#">02/11/2013</a>	Truck 1	1		28	29	0	2.43	3
Chamber Chamber	Cracked Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Structural Structural												
Backlick Run	003453IN	X	435	FERDINAND DAY DR	Sidewalk	<a href="#">02/11/2013</a>	<a href="#">02/11/2013</a>	Truck 1	1		0	0	0	2.43	2
Backlick Run	003457IN	X	444	FERDINAND DAY DR	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		44	45	0	2.43	2
Chamber Chamber Chamber	Cracked I/I evidence Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching	Structural I/I Structural												
Backlick Run	003459IN	X	450	FERDINAND DAY DR	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		51	52	0	2.43	2
Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural												

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003461IN	X	450	FERDINAND DAY DR	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		44	45	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Backlick Run	003464IN	X	400	CAMERON STATION BV	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		37	38	0	2.43	2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003475IN	X	519	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1		37	38	0	2.43	2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003477IN	X	320	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1		15	0	15	2.16	2
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance						
Backlick Run	003478IN	X	5229	TANCRETI LA	Sidewalk	<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1		38	29	15	2.43	2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance						
Backlick Run	003481IN	X	320	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1		45	46	0	2.43	3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	003485IN	X	4926	EISENHOWER AV	Sidewalk	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		48	49	0	2.43	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes						
Backlick Run	003486IN	X	4926	EISENHOWER AV	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces														
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching														
Backlick Run	003486IN	X	4926	EISENHOWER AV	Parking Lot	02/01/2013	02/01/2013	Truck 1	1		37	38	0	2.43	3						
Backlick Run	003488IN	X	5001	EISENHOWER AV	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural											
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping														
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling														
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching														
Backlick Run	003489IN	X	5001	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		42	38	5	2.43	2						
Backlick Run	003490IN	X	5001	EISENHOWER AV	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											
					Chamber	Bricks displaced or missing	Min: <5% of area														
					Chamber	Mortar missing	Mod: 10-25% of area														
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching														
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces														
					Bench	Debris/deposition	Min: <1gal bucket														
Backlick Run	003490IN	X	5001	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		63	62	2	2.43	3						
Backlick Run	003494IN	X	5001	EISENHOWER AV	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling														
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching														
Backlick Run	003494IN	X	5001	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		37	38	0	2.43	1						
Backlick Run	003499IN	X	5001	EISENHOWER AV	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching														
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling														
Backlick Run	003499IN	X	5001	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1	No Access	0	0	0	2.43	4						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	003500IN	X	5001	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		42	43	0	2.43	1
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	003508IN	X	5001	EISENHOWER AV	Sidewalk	02/01/2013	02/01/2013	Truck 1	1		37	38	0	1.35	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	003511IN	X	5001	EISENHOWER AV	Parking Lot	02/01/2013	02/01/2013	Truck 1	1		37	38	0	1.35	3
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	003514IN	X	4900	EISENHOWER AV	Sidewalk	02/01/2013	02/01/2013	Truck 1	1		42	42	0	1.5	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	003515IN	X	4900	EISENHOWER AV	Parking Lot	02/01/2013	02/01/2013	Truck 1	1		56	57	0	0	3
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	003534IN	X	5001	EISENHOWER AV	Parking Lot	02/01/2013	02/01/2013	Truck 1	1		37	38	0	1.35	1
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	003537IN	X	5001	EISENHOWER AV	Parking Lot	02/01/2013	02/01/2013	Truck 1	1		44	45	0	2.43	4
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	003543IN	X	5001	EISENHOWER AV	Parking Lot	02/01/2013	02/01/2013	Truck 1	1		56	56	0	1.35	1
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
				Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	003546IN	X	5001	EISENHOWER AV	Sidewalk	02/01/2013	02/01/2013	Truck 1	1		44	45	0	1.35	2
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	003547IN	X	4840	EISENHOWER AV	Sidewalk	02/01/2013	02/01/2013	Truck 1	1		37	38	0	0	4
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Backlick Run	003549IN	X	4840	EISENHOWER AV	Sidewalk	02/01/2013	02/01/2013	Truck 1	1		37	38	0	1.5	2
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Backlick Run	003551IN	X	4840	EISENHOWER AV	Sidewalk	02/01/2013	02/01/2013	Truck 1	1		0	0	0	1.35	2
Backlick Run	003554SMH	X		EDSALL	Parking Lot	03/14/2013	03/14/2013	Truck 1	1		52	53	0	2.43	4
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
Backlick Run	003567IN	X	5200	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		57	58	0	1.35	3
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Corroded, pitted, spalled		Mod:10-25% mat'l loss, etching	Structural						
					Chamber	Cracked		Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing	Structural						
Backlick Run	003573IN	X	5200	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		50	50	0	0	3
				EISENHOWER AV	Chamber	Corroded, pitted, spalled		Mod:10-25% mat'l loss, etching	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Cracked		Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural						
					Backlick Run	003578IN	X	5249	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1	
				EISENHOWER AV	Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
					Backlick Run	003587IN	X	5301	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1	
				EISENHOWER AV	Frame Base Seal	Cracked / deteriorated		Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural						
					Frame Base Seal	Corroded, pitted, spalled		Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
Backlick Run	003589IN	X	5601	EISENHOWER AV	Sidewalk	03/14/2013	03/14/2013	Truck 1	1		37	38	0	1.5	4
				EISENHOWER AV	Chamber	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
Backlick Run	003597IN	X	5400	EISENHOWER AV	Sidewalk	01/28/2013	01/28/2013	Truck 1	1		37	38	0	2.43	2
				EISENHOWER AV	Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
Backlick Run	003601IN	X	5380	EISENHOWER AV	Parking Lot	01/28/2013	01/28/2013	Truck 1	1		42	43	0	1.35	3
				EISENHOWER AV	Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Pipe Connection-4	Pipe cracked	Min: ~1/16" (2mm) width		Structural						
Backlick Run	003602IN	X	4926	EISENHOWER AV	Parking Lot	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		56	56	0	1.35	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	003983IN	X	151	CAMERON STATION BV	Sidewalk	<a href="#">02/06/2013</a>	<a href="#">02/06/2013</a>	Truck 1	1		37	38	0	1.35	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	003989IN	X	106	MARTIN LA	Sidewalk	<a href="#">02/06/2013</a>	<a href="#">02/06/2013</a>	Truck 1	1		37	38	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	003990IN	X	106	MARTIN LA	Yard-Side	<a href="#">02/06/2013</a>	<a href="#">02/06/2013</a>	Truck 1	1		44	45	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Backlick Run	003991IN	X	106	MARTIN LA	Sidewalk	<a href="#">02/06/2013</a>	<a href="#">02/06/2013</a>	Truck 1	1		37	38	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	003992IN	X	195	CAMERON STATION BV	Sidewalk	<a href="#">02/06/2013</a>	<a href="#">02/06/2013</a>	Truck 1	1		37	38	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	003997IN	X	106	MARTIN LA	Sidewalk	<a href="#">02/21/2013</a>	<a href="#">02/21/2013</a>	Truck 1	1		0	0	0	2.43	2
Backlick Run	003998IN	X	106	MARTIN LA	Sidewalk	<a href="#">02/21/2013</a>	<a href="#">02/21/2013</a>	Truck 1	1		0	0	0	2.43	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	004002IN	X	335	CAMERON STATION BV	Sidewalk	01/15/2013	01/15/2013	Truck 1	1		37	38	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	004005IN	X	5255	COLONEL JOHNSON LA	Sidewalk	01/17/2013	01/17/2013	Truck 1	1		45	46	0	1.35	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	004008IN	X	357	CAMERON STATION BV	Sidewalk	01/17/2013	01/17/2013	Truck 1	1		0	0	0	2.43	2
Backlick Run	004009IN	X	349	CAMERON STATION BV	Light Highway Rural Streets	01/17/2013	01/17/2013	Truck 1	1		56	57	0	2.43	2
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	004010IN	X	349	CAMERON STATION BV	Sidewalk	01/17/2013	01/17/2013	Truck 1	1		43	38	15	2.43	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance						
Backlick Run	004015IN	X	245	CAMERON STATION BV	Sidewalk	01/15/2013	01/15/2013	Truck 1	1		37	38	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	004022IN	X	300	S PICKETT ST		<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1	Not Opened	0	0	0	2.43	0
Backlick Run	004029IN	X	450	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	<a href="#">03/05/2013</a>	Truck 1	1		62	63	0	2.43	3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004032IN	X	499	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	<a href="#">03/05/2013</a>	Truck 1	1		0	0	0	2.43	2
Backlick Run	004035IN	X	401	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	<a href="#">03/05/2013</a>	Truck 1	1		53	53	0	2.43	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Mortar missing	Min: <10% of area		Structural						
Backlick Run	004047IN	X	519	CAMERON STATION BV	Sidewalk	<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	004048IN	X	499	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	<a href="#">03/05/2013</a>	Truck 1	1		59	60	0	2.43	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Bench	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	004049IN	X	401	S PICKETT ST	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		48	45	2	2.16	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Bench	Debris/deposition	Min: <1gal bucket		Maintenance						
Backlick Run	004050IN	X	399	S PICKETT ST	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		50	50	0	2.43	3
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	004051IN	X	4950	BRENMAN PARK DR	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	004080IN	X	300	S PICKETT ST	Parking Lot	03/06/2013	03/06/2013	Truck 1	1		50	50	0	2.43	2
Backlick Run	004081IN	X	300	S PICKETT ST	Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
Backlick Run	004082IN	X	300	S PICKETT ST	Parking Lot	02/11/2013	02/11/2013	Truck 1	1		44	45	0	2.43	4
Backlick Run	004083IN	X	550	S PICKETT ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	004085SMH	X		CAMERON STATION	Curb/Gutter	02/06/2013	02/06/2013	Truck 1	1		41	42	0	1.5	2
Backlick Run	03/05/2013	03/05/2013		S PICKETT ST	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004086IN	X	611	S PICKETT ST	Sidewalk	03/05/2013	03/05/2013	Truck 1	1		37	38	0	2.43	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	004088IN	X	270	S REYNOLDS ST	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		41	38	2	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Debris/deposition	Min: <1gal bucket		Maintenance						
Backlick Run	004090IN	X	240	S REYNOLDS ST	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		41	38	2	2.43	3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Bench	Debris/deposition	Min: <1gal bucket		Maintenance						
Backlick Run	004096IN	X	301	S REYNOLDS ST	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		44	45	0	0	3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Backlick Run	004097IN	X	301	S REYNOLDS ST	Sidewalk	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		37	38	0	0	3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004098IN	X	250	S REYNOLDS ST	Easement	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		44	45	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Backlick Run	004099IN	X	260	S REYNOLDS ST	Easement	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		37	38	0	2.43	4
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	004100IN	X	401	S PICKETT ST	Easement	01/24/2013	01/24/2013	Truck 1	1		44	45	0	1.35	2
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
Backlick Run	004104SMH	X		YOAKUM	Driveway	03/11/2013	03/11/2013	Truck 1	1		40	40	0	1.35	4
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
Backlick Run	004105IN	X	400	S VAN DORN ST	Parking Lot	03/15/2013	03/15/2013	Truck 1	1		37	38	0	0	3
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
Backlick Run	004108SMH	X		EDSALL	Light Highway Rural Streets	03/13/2013	03/13/2013	Truck 1	1		29	29	0	1.35	2
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Backlick Run	004123IN	X	110	S BRAGG ST	Parking Lot	02/06/2013	02/06/2013	Truck 1	1		37	38	0	2.43	2
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Backlick Run	004127IN	X	27	S BRAGG ST	Sidewalk	02/06/2013	02/06/2013	Truck 1	1		71	69	5	2.43	3
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural							
				Chamber	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, etching		Structural							
				Chamber	Mortar missing	Maj: 25-50% of area		Structural							
				Channel	Debris/deposition	Min: <1gal bucket		Maintenance							
Backlick Run	004136IN	X	6300	STEVENSON AV	Sidewalk	03/06/2013	03/06/2013	Truck 1	1		37	38	0	2.43	2
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	004137IN	X	6300	STEVENSON AV	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	1		0	0	0	2.43	2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Sidewalk	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1							
					S BRAGG ST	Yard-Back	<a href="#">02/13/2013</a>	<a href="#">02/13/2013</a>	Truck 1						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I							
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Backlick Run	004139IN	X	99	S BRAGG ST	Sidewalk	<a href="#">02/13/2013</a>	<a href="#">02/13/2013</a>	Truck 1	1		50	51	0	2.43	4
Backlick Run	004140IN	X	85	S BRAGG ST	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	1		57	50	30	0	3
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I							
					Pipe Connection-4	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
Backlick Run	004143IN	X	85	S BRAGG ST	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	1		42	42	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Pipe Connection-2	Roots Intrusion	Maj: 1/8"-3/16" (3-5mm) dia. fingers, 3/8"-3/4" (1-2cm) runners, tap root, mass, mats	Maintenance							
					Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural							
Backlick Run	004144IN	X	85	S BRAGG ST	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	1		28	29	0	1.5	3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Sidewalk	<a href="#">02/13/2013</a>	<a href="#">02/13/2013</a>	Truck 1							
Backlick Run	004226SMH	X		JOHN TICER	Light Highway Rural Streets	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		50	51	0	2.43	2
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004230SMH	X		EISENHOWER	Parking Lot	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		48	49	0	2.43	4
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004231SMH	X		EISENHOWER	Parking Lot	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		48	49	0	2.43	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	004232SMH	X		EISENHOWER	Parking Lot	<a href="#">02/01/2013</a>	<a href="#">02/01/2013</a>	Truck 1	1		48	49	0	2.43	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004234SMH	X		WOODLAND	Parking Lot	<a href="#">01/24/2013</a>	<a href="#">01/24/2013</a>	Truck 1	1		50	50	0	2.43	2
					Frame	Offset	Maj: 3" to 4" (7.5-10cm)		Structural						
Backlick Run	004287IN	X	6301	STEVENSON AV	Sidewalk	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		48	49	0	2.43	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004288IN	X	6125	STEVENSON AV	Easement	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		37	38	0	1.35	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	004338IN	X	200	S WHITING ST	Yard-Back	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		0	0	0	2.43	1
Backlick Run	004339IN	X	200	S WHITING ST	Yard-Back	<a href="#">03/06/2013</a>	<a href="#">03/06/2013</a>	Truck 1	1		98	98	0	2.43	2
					Cover	Cracked / deteriorated	Extreme: separating into pieces		Structural						
Backlick Run	004340IN	X	200	S WHITING ST	Yard-Back	<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1		62	63	0	2.43	3
					Cover	Cracked / deteriorated	Min: <1/16" (2mm) width, tight		Structural						
					Frame Base Seal	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	004341IN	X	110	S BRAGG ST	Sidewalk	<a href="#">02/06/2013</a>	<a href="#">02/06/2013</a>	Truck 1	1		37	38	0	2.43	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	004344IN	X	6161	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1		61	61	0	1.35	3
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Channel	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
Backlick Run	004351IN	X	450	YOAKUM PY	Sidewalk	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1		44	45	0	2.43	3
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004352IN	X	450	YOAKUM PY	Sidewalk	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1		51	52	0	2.43	2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	004353IN	X	450	YOAKUM PY	Sidewalk	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1		44	45	0	2.43	2
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Backlick Run	004354IN	X	6000	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1	No Access	0	0	0	0	0
Backlick Run	004357IN	X	400	S WHITING ST	Easement	<a href="#">03/15/2013</a>	<a href="#">03/15/2013</a>	Truck 1	1		0	0	0	1.35	2
Backlick Run	004369IN	X	400	S VAN DORN ST	Easement	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		58	59	0	2.43	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Bench	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Bench	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Channel	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
Backlick Run	004370IN	X	400	S VAN DORN ST	Easement	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		44	45	0	0	3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004373IN	X	400	S VAN DORN ST	Easement	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		42	42	0	2.16	4
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004392IN	X	201	S VAN DORN ST	Sidewalk	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		44	45	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Backlick Run	004396IN	X	400	S WHITING ST	Easement	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		44	45	0	2.43	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Backlick Run	004397IN	X	400	S WHITING ST	Parking Lot	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		42	42	0	2.43	2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004398IN	X	400	S WHITING ST	Driveway	<a href="#">03/07/2013</a>	<a href="#">03/07/2013</a>	Truck 1	1		37	38	0	2.43	2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	004400IN	X	400	S WHITING ST	Sidewalk	<a href="#">03/15/2013</a>	<a href="#">03/15/2013</a>	Truck 1	1		0	0	0	0	2
Backlick Run	004402IN	X	400	S WHITING ST	Sidewalk	<a href="#">03/14/2013</a>	<a href="#">03/14/2013</a>	Truck 1	1		44	45	0	1.35	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	004933SMH	X	4800	BRENMAN PARK DR	Easement	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		0	0	0	2.43	3
Backlick Run	004934SMH	X	519	CAMERON STATION BV	Light Highway Rural Streets	<a href="#">01/17/2013</a>	<a href="#">01/17/2013</a>	Truck 1	1		56	57	0	2.43	4
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	004935SMH	X	4800	BRENMAN PARK DR	Sidewalk	<a href="#">11/02/2012</a>	<a href="#">11/02/2012</a>	Truck 1	1		70	70	0	2.43	3
					Frame	Offset	Extreme: > 4" (10cm)		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	005044IN	X	245	CAMERON STATION BV	Sidewalk	<a href="#">01/15/2013</a>	<a href="#">01/15/2013</a>	Truck 1	1		9	0	10	2.43	2
					Bench	Debris/deposition	Min: <1gal bucket		Maintenance						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						
Backlick Run	005045IN	X	245	CAMERON STATION BV	Sidewalk	<a href="#">01/15/2013</a>	<a href="#">01/15/2013</a>	Truck 1	1		18	0	19	2.43	2
					Bench	Debris/deposition	Min: <1gal bucket		Maintenance						
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance						
Backlick Run	005055IN	X	5703	EDSALL RD	Sidewalk	<a href="#">03/05/2013</a>	<a href="#">03/05/2013</a>	Truck 1	1		56	56	0	2.43	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
Backlick Run	005056IN	X	611	S PICKETT ST	Sidewalk	<a href="#">03/05/2013</a>	<a href="#">03/05/2013</a>	Truck 1	1		37	38	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Backlick Run	005057IN	X	333	S REYNOLDS ST	Sidewalk	03/05/2013	03/05/2013	Truck 1	1		56	56	0	1.35	3
				Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	005058IN	X	423	S REYNOLDS ST	Sidewalk	03/05/2013	03/05/2013	Truck 1	1		37	38	0	2.43	2
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Backlick Run	005059IN	X	423	S REYNOLDS ST	Sidewalk	03/05/2013	03/05/2013	Truck 1	1		37	38	0	2.43	2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	005060IN	X	423	S REYNOLDS ST	Sidewalk	03/05/2013	03/05/2013	Truck 1	1		36	15	25	2.43	2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Bench	Debris/deposition	Mod: 1-3gal bucket			Maintenance						
				Channel	Debris/deposition	Mod: 1-3gal bucket			Maintenance						
Backlick Run	005073IN	X	211	YOAKUM PY	Sidewalk	03/11/2013	03/11/2013	Truck 1	1		42	42	0	2.43	2
				Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Backlick Run	005074IN	X	211	YOAKUM PY	Parking Lot	03/11/2013	03/11/2013	Truck 1	1		0	0	0	0	2
Backlick Run	005082IN	X	211	YOAKUM PY	Sidewalk	03/13/2013	03/13/2013	Truck 1	1		42	43	0	2.43	3
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Backlick Run	005083IN	X	400	YOAKUM PY	Sidewalk	03/13/2013	03/13/2013	Truck 1	1		58	58	0	2.43	3
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I						
Backlick Run	005084IN	X	300	YOAKUM PY	Easement	<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1		55	51	15	2.43	2
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance						
Backlick Run	005087IN	X	6135	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1		44	45	0	1.35	3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	005092IN	X	6200	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1		37	38	0	2.43	3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	005093IN	X	6200	EDSALL RD	Sidewalk	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1		37	38	0	1.35	3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Backlick Run	005106IN	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1		46	46	0	2.43	3
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Backlick Run	005107IN	X	211	YOAKUM PY	Parking Lot	<a href="#">03/11/2013</a>	<a href="#">03/11/2013</a>	Truck 1	1		37	38	0	2.43	2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Backlick Run	009209IN	X		EDSALL	Sidewalk	<a href="#">03/13/2013</a>	<a href="#">03/13/2013</a>	Truck 1	1		63	63	0	2.43	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural						
				Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing			Structural						
				Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Channel	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural						



## **Appendix C – Summary of Structures Not Inspected**



Facility ID	Why Not Inspected
000449ND	Not Inspected - Not found
000555ND	Not Inspected - Not found
001447SMH	Not Inspected - Not found
001448SMH	Not Inspected - Not found
001780SMH	Not Inspected - Not found
001781SMH	Not Inspected - Not found
001782SMH	Not Inspected - Not found
002256ND	Not Inspected - Not found
000364ND	Not Inspected - No Access
000377ND	Not Inspected - No Access
000378ND	Not Inspected - No Access
000383ND	Not Inspected - No Access
000403ND	Not Inspected - No Access
000408ND	Not Inspected - No Access
000409ND	Not Inspected - No Access
000411ND	Not Inspected - No Access
000421ND	Not Inspected - No Access
000422ND	Not Inspected - No Access
000450ND	Not Inspected - No Access
000451ND	Not Inspected - No Access
000505ND	Not Inspected - No Access
000519ND	Not Inspected - No Access
000668ND	Not Inspected - No Access
000675ND	Not Inspected - No Access
000676ND	Not Inspected - No Access
000677ND	Not Inspected - No Access
000678ND	Not Inspected - No Access
002252ND	Not Inspected - No Access
003382IN	Not Inspected - No Access
003499IN	Not Inspected - No Access
004022IN	Not Inspected - No Access
004354IN	Not Inspected - No Access



## **Appendix D - Summary of Observed Pipe Defects**



# SCREAMTM Lampina - Summary of Observed Defects

## Alexandria - Backlick Run

Pipe	SCREAM Total Score	USMH Bldg	MH Street	Observed	Inventory	Maintenance	Structural
				Infiltration	Information	Roots	Crack
				Infiltration (Count)	General Remark (Count)	Roots (Length)	Cracks Multiple (Length)
<u>000229CP-000229CP</u>	7	99	BRAGG ST	1	0	0	0
<u>002264ND-004139IN</u>	7	99	BRAGG ST	1	1	0	0
<u>002265ND-004139IN</u>	7	99	BRAGG ST	1	1	0	0
<u>001361SMH-004287IN</u>	7	6060	TOWER CT	1	0	0	0
<u>001768SMH-001764SMH</u>	7	350	YOAKUM PY	1	0	0	0
<u>001764SMH-005082IN</u>	7	400	YOAKUM PY	1	0	0	0
<u>005082IN-005083IN</u>	7	400	YOAKUM PY	1	0	0	0
<u>000284IO-001374SMH</u>	7	6325	STEVENSON AV	1	0	0	0
<u>003124IN-003123IN</u>	7	5835	PEARSON LA	1	0	0	0
<u>004140IN-004139IN</u>	7	85	BRAGG ST	1	0	0	0
<u>004139IN-001333SMH</u>	8	99	BRAGG ST	2	0	0	0
<u>001333SMH-004138IN</u>	8	99	BRAGG ST	2	0	0	0
<u>004138IN-001335SMH</u>	8	99	BRAGG ST	2	0	0	0
<u>001335SMH-000605IO</u>	8	99	BRAGG ST	2	0	0	0
<u>003601IN-001166SMH</u>	9	5263	EISENHOWER	0	0	0	4
<u>004141IN-004140IN</u>	50	85	BRAGG ST	0	0	4	0
Total				18	54	4	4